
**RENNSPORT AUTOMOTIVE**
**353 ADAMS STREET**
**BEDFORD HILLS, NY 10507**
**PHONE (914) 241-3338**


Service: 03-19-2024
**Invoice #: 20611**

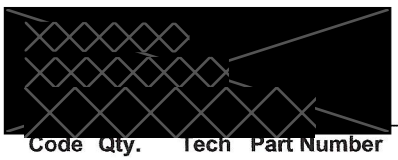

| Code | Qty. | Tech | Part Number | Description | Each Price | Total |
|---|---|---|---|---|---|---|
| 1 | 1.7 | MS | L | 25 point Lube Service<br><br>Change engine oil & filter. Lube throttle linkages. Check air filter. Check for any leaks. Check brake fluid. Check brakes, brake hoses, parking brake cables & function. Check tires including spare. Set tire pressures. Check coolant/antifreeze mixture level and degree rating. Check all fluids and top up if needed. Check belts. Check windshield washer function and blades. Check lights. Check exhaust system condition & hangers. Service battery. Reset service indicator. Stamp maintenance book. | | 275.40 |
| 1 | 0.5 | MS | L | Tighten belts | | 81.00 |
| 1 | 0.1 | MS | L | Replace blown right front marker light bulb | | 16.20 |
| 1 | 2.7 | MS | L | Check for smoke . found oil leak. Wash off engine to determine leak road test. Found leak coming from cam holders. Inspect further remove valve covers. Found head studs broken | | 437.40 |
| 1 | 132.6 | MS | L | Remove engine and disassemble. Inspect and access.Replace broken head studs with updated studs. Have heads redone and replace all necessary parts including oil pump, piston rings,rod bushings. Have crankshaft checked and polished. Assemble engine and install. | | 21,481.20 |
| 1 | 1 | MS | SUBLET | Check and polish crankshaft. R&R wrist pin bushings, Replace worn intake seats and general head machining | 1,668.75 | 1,668.75 |
| 1 | 1.8 | MS | L | Replace leaking slave clyinder | | 291.60 |
| 1 | 0.6 | MS | L | Replace faulty windshield washer pump | | 97.20 |
| 1 | 0.8 | MS | L | Replace leaking oil hose to front oil cooler | | 129.60 |
| 1 | 1.5 | MS | L | Found engine running hot after rebuild. Found thermostat to front engine oil cooler not opening. Replace thermostat | | 243.00 |
| 1 | 4 | MS | L | Bead blast all engine tins and refinish | | 648.00 |
| 1 | 0.5 | MS | L | Install supplied shifter knob | | 81.00 |
| 1 | 1 | MS | SUBLET | Grind Camshafts to 964 Spec | 850.00 | 850.00 |
| 1 | 1 | MS | PROFORMANCE | Powder Coat Fan/Housing | 200.00 | 200.00 |
| 1 | 1 | MS | 91110700805 | Oil Pump | 1,486.78 | 1,486.78 |
| 1 | 2 | MS | 93010505803 | Chain Tensioner | 512.56 | 1,025.12 |
| 1 | 12 | MS | 90110116103 | Washer | 8.36 | 100.32 |
| 1 | 1 | MS | 93020711306 | Oil Line | 238.35 | 238.35 |
| 1 | 1 | MS | 93010701701 | Thermostat | 557.17 | 557.17 |
| 1 | 1 | MS | 91160201203 | Ignition Wire Set Left Bank | 544.34 | 544.34 |
| 1 | 1 | MS | 91160201104 | Ignition Wire Set Right Bank | 544.34 | 544.34 |
| 1 | 12 | MS | 99310117054 | Stud | 65.18 | 782.16 |
| 1 | 12 | MS | 93010433150 | Valve Guide | 41.89 | 502.68 |
| 1 | 2 | MS | 99911341840 | Shaft Seal | 3.88 | 7.76 |
| 4 | 1 | MS | 90002910202 | Screw, Wing | 4.13 | 4.13 |

**RENNSPORT AUTOMOTIVE**
**353 ADAMS STREET**
**BEDFORD HILLS, NY 10507**
**PHONE (914) 241-3338**


Service: 03-19-2024
**Invoice #: 20611**

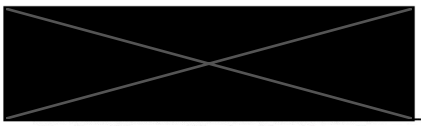

| Code | Qty. | Tech | Part Number | Description | Each Price | Total |
|---|---|---|---|---|---|---|
| 1 | 1 | MS | 91120126302 | Restrictor | 3.79 | 3.79 |
| 1 | 13 | MS | 93010117202 | Nut | 20.40 | 265.20 |
| 1 | 24 | MS | 90003101430 | Valve Cover Washers | 1.01 | 24.24 |
| 1 | 1 | MS | 93010090104 | Gasket Set, Low Engine | 117.05 | 117.05 |
| 1 | 1 | MS | 93010779102 | Rear Cover Gasket | 11.90 | 11.90 |
| 1 | 3 | MS | 91462874100 | Rubber Mounts | 7.28 | 21.84 |
| 1 | 1 | MS | 92862807401 | Wiper Washer Pump | 129.13 | 129.13 |
| 1 | 2 | MS | 91160621502 | Sender | 360.40 | 720.80 |
| 1 | 1 | MS | 90019202750 | V BELT, AC | 18.65 | 18.65 |
| 1 | 1 | MS | 9991921765A | Alternator Belt 7x910 | 16.00 | 16.00 |
| 1 | 1 | MS | 93060611800 | Temp Sensor On Oil Cool. | 115.63 | 115.63 |
| 1 | 1 | MS | 90110527500 | Cap | 14.83 | 14.83 |
| 1 | 2 | MS | 99610113780 | Shaft Bearing | 126.91 | 253.82 |
| 1 | 2 | MS | 99610143571 | Bearing | 31.60 | 63.20 |
| 1 | 6 | MS | 99908500103 | Collar | 10.80 | 64.80 |
| 1 | 2 | MS | 93010504300 | Rocker Arm | 237.63 | 475.26 |
| 1 | 24 | MS | 90110438203 | Gasket | 11.01 | 264.24 |
| 1 | 1 | MS | 90012300730 | Seal | 0.97 | 0.97 |
| 1 | 1 | MS | 99970169040 | Seal At Chain Tensioner | 5.08 | 5.08 |
| 1 | 24 | MS | 99903109101 | Head Bolt Washers | 14.84 | 356.16 |
| 1 | 1 | MS | 91160218303 | Cable Holder | 18.48 | 18.48 |
| 1 | 1 | MS | 92860255400 | Cable Clip | 3.90 | 3.90 |
| 1 | 1 | MS | 95011623712 | Clutch Slave Cylinder | 237.50 | 237.50 |
| 1 | 12 | MS | 90110534403 | Spacer | 6.59 | 79.08 |
| 1 | 12 | MS | 90110537603 | Nut | 8.30 | 99.60 |
| 1 | 1 | MS | 90110753101 | Spring | 8.29 | 8.29 |
| 1 | 2 | MS | 91110751200 | Oil Pressure Relief Valve | 23.19 | 46.38 |
| 1 | 1 | MS | 93010753101 | Spring | 10.03 | 10.03 |
| 1 | 1 | MS | 93010620902 | Pully Half | 122.03 | 122.03 |
| 1 | 1 | MS | 9301065640Y | Shim | 3.25 | 3.25 |
| 1 | 2 | MS | 90012310630 | Aluminum Seal - Porsche | 2.73 | 5.46 |
| 1 | 4 | MS | 99970417250 | Seal | 11.64 | 46.56 |
| 4 | 6 | MS | 99907200501 | Hex Head | 3.77 | 22.62 |
| 0 | 31 | MS | 90003101130 | Washer, Timing Cover, 6mm Thick Aluminum | 1.35 | 41.85 |

**RENNSPORT AUTOMOTIVE**
**353 ADAMS STREET**
**BEDFORD HILLS, NY 10507**
**PHONE (914) 241-3338**


Service: 03-19-2024
**Invoice #: 20611**

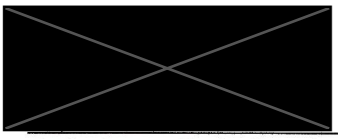

| Code | Qty. | Tech | Part Number | Description | Each Price | Total |
|---|---|---|---|---|---|---|
| 1 | 6 | MS | 94411090100 | Injector Seal Set | 21.90 | 131.40 |
| 1 | 1 | MS | 99920136501 | Clutch Fork Bearing | 15.30 | 15.30 |
| 1 | 4 | MS | 99950707300 | Stainless Speednut Porsche | 20.53 | 82.12 |
| 1 | 1 | MS | 93010108901 | Impulse Sender Bracket | 167.81 | 167.81 |
| 1 | 1 | MS | 00004300400 | Mounting | 33.69 | 33.69 |
| 1 | 1 | MS | N01152427 | Washer | 0.50 | 0.50 |
| 4 | 2 | MS | 90037803001 | Hex Head | 1.42 | 2.84 |
| 1 | 24 | MS | 91109910352 | Seal | 6.00 | 144.00 |
| 1 | 33 | MS | 99907503903 | Wheel Bolt | 3.58 | 118.14 |
| 1 | 1 | MS | 90001206100 | Pin | 1.00 | 1.00 |
| 1 | 1 | MS | 90110214700 | Woodruff Key | 12.31 | 12.31 |
| 1 | 2 | MS | 91110522205 | Guide Rail | 67.60 | 135.20 |
| 1 | 6 | MS | 93010313401 | Piston Sleeve | 25.88 | 155.28 |
| 1 | 6 | MS | 93010314715 | Glyco Rod Bearing Set (Standard) | 58.89 | 353.34 |
| 1 | 6 | MS | 93010398600 | Piston rings set | 84.88 | 509.28 |
| 1 | 6 | MS | 93010419402 | Cylinder Gasket | 6.51 | 39.06 |
| 1 | 1 | MS | 96410190100 | Main Bearing Set | 868.49 | 868.49 |
| 1 | 12 | MS | 99310317403 | Connecting Rod Nuts | 9.35 | 112.20 |
| 1 | 1 | MS | N1010900A | Straight | 3.16 | 3.16 |
| 1 | 1 | MS | PAF013334 | Roll Pin | 3.58 | 3.58 |
| 1 | 2 | MS | 99310552900 | Timing Chain | 120.18 | 240.36 |
| 1 | 4 | MS | 90110735101 | Oil Return Tube | 30.76 | 123.04 |
| 1 | 6 | MS | 93010438101 | Head Gasket | 22.24 | 133.44 |
| 1 | 24 | MS | 96410411107 | Seal | 13.64 | 327.36 |
| 1 | 8 | MS | 9997071124A | Seal | 12.84 | 102.72 |
| 1 | 2 | MS | 90006716102 | Muffler Clamp Screw | 6.73 | 13.46 |
| 1 | 3 | MS | 90007482803 | Bolt | 6.48 | 19.44 |
| 1 | 34 | MS | 90091009701 | Nut | 6.64 | 225.76 |
| 1 | 1 | MS | 91111119102 | Exhaust Hardware | 10.34 | 10.34 |
| 1 | 1 | MS | 93011115900 | Muffler Mounting Strap | 99.83 | 99.83 |
| 1 | 1 | MS | 93011119703 | Retainer | 27.28 | 27.28 |
| 1 | 6 | MS | PCG07505702 | Bolt | 2.13 | 12.78 |
| 1 | 1 | MS | 95011671004 | Clutch Fork Shaft | 128.90 | 128.90 |
| 1 | 1 | MS | 95011671302 | Shaft Support | 5.73 | 5.73 |

**RENNSPORT AUTOMOTIVE**
**353 ADAMS STREET**
**BEDFORD HILLS, NY 10507**
**PHONE (914) 241-3338**

Service: 03-19-2024
**Invoice #: 20611**

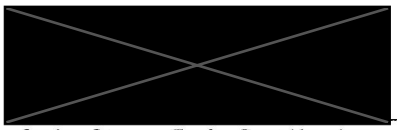

| Code | Qty. | Tech | Part Number | Description | Each Price | Total |
|---|---|---|---|---|---|---|
| 1 | 3 | MS | 95011672500 | Cover, Shaft | 4.45 | 13.35 |
| 1 | 3 | MS | 99920133901 | Bearing | 9.65 | 28.95 |
| 1 | 5 | MS | 91110522207 | Rail | 25.28 | 126.40 |
| 1 | 1 | MS | 90010400303 | Union Nut | 50.56 | 50.56 |
| 1 | 1 | MS | 91160613500 | Oil Pressure Sender(can) | 114.38 | 114.38 |
| 1 | 1 | MS | 93010734716 | Oil Pipe | 69.11 | 69.11 |
| 1 | 1 | MS | 9301073471Y | Left Side Cam Oil Line | 139.38 | 139.38 |
| 1 | 1 | MS | N0208251 | Ferrule | 3.88 | 3.88 |
| 1 | 1 | MS | 95011681307 | Guide Tube | 190.06 | 190.06 |
| 1 | 1 | MS | 91160623000 | Oil Pressure Sender, Red | 38.35 | 38.35 |
| 1 | 1 | MS | 90012300920 | Seal | 1.45 | 1.45 |
| 1 | 1 | MS | PCG04330087 | Sealing Compound | 34.09 | 34.09 |
| 1 | 1 | MS | 93011117500 | Muffler Strap | 99.83 | 99.83 |
| 1 | 1 | MS | 93010090704 | Head & Upper Engine Gasket Set | 377.10 | 377.10 |
| 1 | 1 | MS | 93010601201 | Fan | 722.45 | 722.45 |
| 1 | 1 | MS | COL111121 | Fan Housing | 471.64 | 471.64 |
| 1 | 1 | MS | 93010753301 | Guide | 15.58 | 15.58 |
| 4 | 1 | MS | 96410625120 | Fan Housing Strap | 37.31 | 37.31 |
| 1 | 12 | MS | 96410317605 | Connecting Rod Bolt | 31.78 | 381.36 |
| 1 | 2 | MS | 91160342801 | Alternator Mount Washer | 20.68 | 41.36 |
| 1 | 1 | MS | 99311341840 | Gasket | 3.86 | 3.86 |
| 4 | 2 | MS | 92860390400 | Alternator Pulley Nut Kit | 37.98 | 75.96 |
| 1 | 6 | MS | 99917015690 | Spark Plug | 25.80 | 154.80 |
| 1 | 2 | MS | 91160312701 | Cap | 12.24 | 24.48 |
| 1 | 1 | MS | 93060691500 | Temp sensor II | 301.38 | 301.38 |
| 1 | 2 | MS | 90110536103 | Cam Oil Fitting Restricted | 20.66 | 41.32 |
| 1 | 20 | MS | 90008400402 | Valve Cover Nut | 1.80 | 36.00 |
| 1 | 1 | MS | 93010776403 | Oil Filter | 19.77 | 19.77 |
| 0 | 2 | MS | 00004320931 | Classic Motoroil 10W60 Porsche 5L | 89.97 | 179.94 |
| 0 | 1 | MS | 4632227 | Aluminum Seal Ring | 2.43 | 2.43 |
| 0 | 1 | MS | 4602227 | Copper Seal Ring | 1.59 | 1.59 |
| 1 | 7 | MS | 089093000 | Multi - Purpose Solvent | 11.00 | 77.00 |
| 1 | 2 | MS | 96462890102 | Wiper Blade | 34.19 | 68.38 |
| 0 | 1 | MS | 90012301120 | Seal | 1.73 | 1.73 |

**RENNSPORT AUTOMOTIVE**
**353 ADAMS STREET**
**BEDFORD HILLS, NY 10507**
**PHONE (914) 241-3338**

Service: 03-19-2024
**Invoice #: 20611**

[redacted]

| Code | Qty. | Tech | Part Number | Description | Each Price | Total |
|---|---|---|---|---|---|---|
| 1 | 12 | MS | 91110117200 | Upper Stud | 17.03 | 204.36 |
| 0 | 6 | MS | 90002508001 | Washer | 3.69 | 22.14 |
| 0 | 38 | MS | 90091004709 | Lock Nut | 5.89 | 223.82 |
| 0 | 1 | MS | 90007505703 | Hex Head | 4.56 | 4.56 |
| 0 | 2 | MS | 90006700803 | Bolt | 1.84 | 3.68 |
| 0 | 12 | MS | N01474011 | Bolt | 2.04 | 24.48 |
| 0 | 4 | MS | 90015100603 | Washer | 0.95 | 3.80 |
| 0 | 24 | MS | PCG91002202 | Lock Nut | 2.29 | 54.96 |
| 6 | 5 | MS | FREIGHT | Freight | 30.00 | 150.00 |
| 1 | 1 | MS | 3893 | Bulb | 1.68 | 1.68 |
| 0 | 1 | MS | FUEL | Fuel | 79.31 | 79.31 |
| 0 | 1 | MS | NYS | NYS Inspection | 10.00 | 10.00 |

Vehicle: 1988 PORSCHE 911 CARRERA 3.2L H6 F
License: HX98365
Vin: WP0EB0918JS160158
Miles: 30364
Home: 914- -
Work: - -

[redacted]

I hereby authorize the repair work herein set forth to be done by you, together with the furnishing by you of the necessary parts and other material for such repair, and agree: that you are not responsible for any delays caused by unavailability or delayed availability of pai and material for any reason: that you neither assume nor authorize any other person to assume for you any liability in connection with such repair; that you shall not be responsible for loss of or damage to the above vehicle, or articles left therein; in case of fire, theft or other cause beyond your control; that an express mechanic's lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto; that your employees may operate the above vehicle on streets, highways or elsewhere for purpose of testing and/or inspecting such vehicle.


**SIGNATURE OF OWNER** _____

TEARDOWN ESTIMATE: _____ $

| Department | Amount |
|---|---|
| Labor | 23,781.60 |
| fuel | 79.31 |
| Parts | 21,197.37 |
| N.Y.State Inspection | 10.00 |
| Shop Supplies | 0.00 |
| Discount | 0.00 |
| Tire Disp. Fee | 0.00 |
| **SUB TOTAL** | **45,068.28** |
| Sales Tax | 3,762.53 |
| NYS Tire Tax | 0.00 |
| **TOTAL** | **48,830.81** |
| **BALANCE** | **33,830.81** |

**RENNSPORT AUTOMOTIVE**
**353 ADAMS STREET**
**BEDFORD HILLS, NY 10507**
**PHONE (914) 241-3338**

Service: 05-19-2022
**Invoice #: 20103**

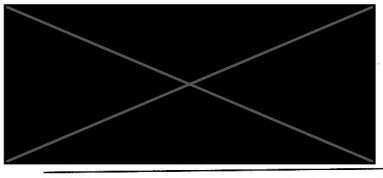

| Code | Qty. | Tech | Part Number | Description | Each Price | Total |
|---|---|---|---|---|---|---|
| 1 | 1.7 | JZ | L | 25 point Lube Service<br>Change engine oil & filter. Lube throttle linkages. Check air filter. Check for any leaks. Check brake fluid. Check brakes, brake hoses, parking brake cables & function. Check tires including spare. Set tire pressures. Check coolant/antifreeze mixture level and degree rating. Check all fluids and top up if needed. Check belts. Check windshield washer function and blades. Check lights. Check exhaust system condition & hangers. Service battery. Reset service indicator. Stamp maintenance book. | | 275.40 |
| 1 | 2 | JZ | L | Replace tires and balance | | 324.00 |
| 1 | 0.5 | JZ | L | Replace fuel filter | | 81.00 |
| 1 | 0.3 | JZ | L | Remove and send out speedo for repair | | 48.60 |
| 1 | 1.5 | JZ | L | Replace brake fluid ( every two years ) | | 243.00 |
| 1 | 2.5 | JZ | L | Perform alignment | | 405.00 |
| 1 | 0.2 | JZ | L | Road test | | 32.40 |
| 1 | 2 | JZ | 05667 | Michelin Pilot PE2 225/50ZR16 92Y NO Porsche | 211.06 | 422.12 |
| 1 | 2 | JZ | 81866 | Michelin Pilot PE2 205/55ZR16 91Y NO Porsche | 179.63 | 359.26 |
| 6 | 1 | JZ | FREIGHT | Freight (Tires) | 60.32 | 60.32 |
| 6 | 1 | JZ | FREIGHT | Freight (speedo outgoing ) | 20.88 | 20.88 |
| 1 | 1 | JZ | 92811025307 | Fuel Filter | 46.63 | 46.63 |
| 1 | 1 | JZ | 93011039300 | Air Filter | 26.49 | 26.49 |
| 0 | 4 | JZ | TEC413 | Valve Stem Short | 0.60 | 2.40 |
| 0 | 2 | JZ | 00004320931 | Classic Motoroil 10W60 Porsche 5L | 81.77 | 163.54 |
| 1 | 1 | JZ | 93010776403 | Oil Filter | 15.82 | 15.82 |
| 0 | 20 | JZ | 8301460 | Tape Weight 5 Gram | 0.85 | 17.00 |
| 0 | 1 | JZ | FUEL | Fuel | 100.00 | 100.00 |
| 1 | 1 | JZ | BF41 | Brake fluid | 23.65 | 23.65 |
| 0 | 1 | JZ | NYS | NYS Inspection | 10.00 | 10.00 |

**RENNSPORT AUTOMOTIVE**
**353 ADAMS STREET**
**BEDFORD HILLS, NY 10507**
**PHONE (914) 241-3338**

Service: 05-19-2022
**Invoice #: 20103**

[redacted]

| Code | Qty. | Tech | Part Number | Description | Each Price | Total |
|---|---|---|---|---|---|---|

Vehicle: 1988 PORSCHE 911 CARRERA 3.2L H6 F
License: HX98365
Vin: WP0EB0918JS160158
Miles: 152000
Home: 914- -
Work: - -

[redacted]

I hereby authorize the repair work herein set forth to be done by you, together with the furnishing by you of the necessary parts and other material for such repair, and agree: that you are not responsible for any delays caused by unavailability or delayed availability of parts and material for any reason: that you neither assume nor authorize any other person to assume for you any liability in connection with such repair; that you shall not be responsible for loss of or damage to the above vehicle, or articles left therein; in case of fire, theft or other cause beyond your control; that an express mechanic's lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto; that your employees may operate the above vehicle on streets, highways or elsewhere for purpose of testing and/or inspecting such vehicle.

[redacted]R _____

[redacted]: _____ $

| Department | Amount |
|---|---|
| Labor | 1,409.40 |
| fuel | 100.00 |
| Parts | 1,158.11 |
| N.Y.State Inspection | 10.00 |
| Shop Supplies | 0.00 |
| Discount | 0.00 |
| Tire Disp. Fee | 0.00 |
| **SUB TOTAL** | **2,677.51** |
| Sales Tax | 215.16 |
| NYS Tire Tax | 10.00 |
| **TOTAL** | **2,902.67** |
| **BALANCE** | **2,902.67** |

**RENNSPORT AUTOMOTIVE**
**353 ADAMS STREET**
**BEDFORD HILLS, NY 10507**
**PHONE (914) 241-3338**

Service: 06-14-2022
**Invoice #: 20133**

[redacted]

| Code | Qty. | Tech | Part Number | Description | Each Price | Total |
|---|---|---|---|---|---|---|
| 1 | 0.3 | CZ | L | Install speedometer | | 48.60 |
| 1 | 0.2 | CZ | L | Install supplied exhaust tip | | 32.40 |
| 1 | 1 | CZ | PALOALTO | Repair and calibrate VDO speedometer | 425.00 | 425.00 |
| 6 | 1 | CZ | FREIGHT | Freight | 32.24 | 32.24 |
| 0 | 1 | CZ | 7203898 | 12v-2w Socket Bulb (dash | 1.91 | 1.91 |

Vehicle: 1988 PORSCHE 911 CARRERA 3.2L H6 F
License: HX98365
Vin: WP0EB0918JS160158
Miles: 151850
Home: 914- -
Work: - -

[redacted]

I hereby authorize the repair work herein set forth to be done by you, together with the furnishing by you of the necessary parts and other material for such repair, and agree: that you are not responsible for any delays caused by unavailability or delayed availability of parts and material for any reason: that you neither assume nor authorize any other person to assume for you any liability in connection with such repair; that you shall not be responsible for loss of or damage to the above vehicle, or articles left therein; in case of fire, theft or other cause beyond your control; that an express mechanic's lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto; that your employees may operate the above vehicle on streets, highways or elsewhere for purpose of testing and/or inspecting such vehicle.

**SIGNATURE OF OWNER** _____

TEARDOWN ESTIMATE: _____ $ _____

| Department | Amount |
|---|---|
| Labor | 81.00 |
| Parts | 459.15 |
| Shop Supplies | 0.00 |
| Discount | 0.00 |
| Tire Disp. Fee | 0.00 |
| **SUB TOTAL** | **540.15** |
| Sales Tax | 45.26 |
| NYS Tire Tax | 0.00 |
| **TOTAL** | **585.41** |
| **BALANCE** | **585.41** |

**RENNSPORT AUTOMOTIVE**
**353 ADAMS STREET**
**BEDFORD HILLS, NY 10507**
**PHONE (914) 241-3338**

Service: 07-14-2021
**Invoice #: 19797**

[redacted]

| Code | Qty. | Tech | Part Number | Description | Each Price | Total |
|---|---|---|---|---|---|---|
| 1 | 1.3 | CZ | L | Check for oil leak.Tighten valve cover nuts and wash off area wash off and road test . Found oil drain back tubes leaking. | | 210.60 |
| 1 | 10 | CZ | L | Replace leaking drain back tubes. Recheck after road test. Has slight leak from oil cooler seals or cylinder seals. Ok for now main leak fixed | | 1,620.00 |
| 1 | 0.7 | CZ | L | Reseat windshield mirror | | 113.40 |
| 1 | 4 | CZ | 93010704001 | Teliscopic Oil Ret.Tubes | 73.99 | 295.96 |
| 0 | 1 | CZ | 00004320931 | Classic Motoroil 10W60 Porsche 5L | 76.66 | 76.66 |
| 1 | 1 | CZ | 089093000 | Multi - Purpose Solvent | 11.00 | 11.00 |
| 4 | 1 | CZ | PTX81844 | Mirror Sealant | 7.88 | 7.88 |
| 0 | 1 | CZ | FUEL | Fuel | 72.00 | 72.00 |

Vehicle: 1988 PORSCHE 911 CARRERA 3.2L H6 F
License: HX98365
Vin: WP0EB0918JS160158
Miles: 151848
Home: 914- -
Work: - -

[redacted]

I hereby authorize the repair work herein set forth [redacted] furnishing by you of the necessary parts and other material for such repair, and agree: that you are not responsible for any delays caused by unavailability or delayed availability of parts and material for any reason: that you neither assume nor authorize any other person to assume for you any liability in connection with such repair; that you shall not be responsible for loss of or damage to the above vehicle, or articles left therein; in case of fire, theft or other cause beyond your control; that an express mechanic's lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto; that your employees may operate the above vehicle on streets, highways or elsewhere for purpose of testing and/or inspecting such vehicle.

**SIGNATURE OF OWNER** _____

TEARDOWN ESTIMATE: _____ $

| Department | Amount |
|---|---|
| Labor | 1,944.00 |
| fuel | 72.00 |
| Parts | 391.50 |
| Shop Supplies | 0.00 |
| Discount | 0.00 |
| Tire Disp. Fee | 0.00 |
| **SUB TOTAL** | **2,407.50** |
| Sales Tax | 195.71 |
| NYS Tire Tax | 0.00 |
| **TOTAL** | **2,603.21** |
| **BALANCE** | **2,603.21** |

**Service Invoice**

# RENNSPORT AUTOMOTIVE

353 ADAMS STREET
BEDFORD HILLS, NY 10507
PHONE (914) 241-3338

**Invoice #:** 19593
**Service:** 12-18-2020
**Time:** 4:52:51 PM

[redacted]t
[redacted]

**Work:** - -

**Vehicle:** 1988 PORSCHE 911 **Vin:** WP0EB0918JS160158 **License** HX98365 **Miles:** 151,250

| Code | Qty. | Part Number | Description | Each Price | Total |
|---|---|---|---|---|---|
| 1 | 1.7 | | 25 point Lube Service<br>Change engine oil & filter. Lube throttle linkages. Check air filter. Check for any leaks. Check brake fluid. Check brakes, brake hoses, parking brake cables & function. Check tires including spare. Set tire pressures.. Check all fluids and top up if needed. Check belts. Check windshield washer function and blades. Check lights. Check exhaust system condition & hangers Service battery. ( completed ) | | |
| 1 | 1 | 93010776403 | Oil Filter | 15.82 | 15.82 |
| 0 | 2 | 00004320931 | Classic Motoroil 10W60 Porsche 5L | 76.66 | 153.32 |
| 0 | 1 | NYS | NYS Inspection | 10.00 | 10.00 |
| | | | **Subtotal for SERVICE** | | **454.54** |
| 1 | 1.5 | | Check and repair front and rear maker lights out. Three lights had bad bulbs and one had bad connection. Replace bulbs and repair connector | | 243.00 |
| 1 | 4 | 3893 | Light Bulb | 1.68 | 6.72 |
| | | | **Subtotal for MARKER LIG** | | **249.72** |
| 1 | 0.5 | | Glue glove compartment cover to door ( Completed ) | | 81.00 |
| | | | **Subtotal for GLOVE** | | **81.00** |
| 1 | 2.5 | | Replace signal stalk high / low beam faulty and faulty wiper switch ( wiper does not always park ) | | 405.00 |
| 1 | 1 | 91161330501 | Headlamp Stalk Switch | 342.90 | 342.90 |
| | | | **Subtotal for STALK** | | **747.90** |
| 1 | 3 | | Replace rotted window holding rail | | 486.00 |
| 1 | 1 | 91154205742 | Window Lifter Rail | 521.95 | 521.95 |
| 1 | 1 | 91154249140 | Lifter Rail Rubber Seal | 18.50 | 18.50 |
| 1 | 1 | 91153129540 | Drivers door seal | 153.28 | 153.28 |
| | | | **Subtotal for WINDOW** | | **1,179.73** |
| 1 | 3.5 | | Replace leaking valve cover gaskets, check and adjust valves | | 567.00 |
| 1 | 1 | 93010590201 | Valve Cover Gasket Set | 69.98 | 69.98 |
| | | | **Subtotal for VALVE** | | **636.98** |
| 1 | 0.5 | | Replace battery | | 81.00 |
| 4 | 1 | MTP49/H8 | Battery | 220.00 | 220.00 |
| 4 | 1 | 91161120900 | Battery Hold Bracket | 15.79 | 15.79 |
| 0 | 1 | 90006701803 | Bolt | 2.16 | 2.16 |
| | | | **Subtotal for BATTERY** | | **318.95** |
| 1 | 1.5 | | Replace Leaking right side cam oil line | | 243.00 |
| 1 | 1 | 90010400303 | Union Nut | 34.91 | 34.91 |
| 1 | 1 | 93010734812 | Oil Hose | 152.64 | 152.64 |
| | | | **Subtotal for CAM LINE** | | **430.55** |
| 1 | 3.5 | | Replace leaking oil lines to thermostat from oil tank including S hose. Replace oil level sensor after seeing condition of sensor when replacing leaking gasket | | 567.00 |
| 1 | 1 | 91110723300 | Oil Tank To Engine Hose | 98.54 | 98.54 |
| 1 | 1 | 91110773013 | Oil Pipe | 302.38 | 302.38 |
| 4 | 1 | 99965901150 | Boot @ Wire To Oil Sendr | 10.52 | 10.52 |
| 0 | 2 | 99951209100 | Special Hose Clamps | 16.26 | 32.52 |
| 1 | 1 | 93010774315 | Oil Line | 264.68 | 264.68 |

**Service Invoice**

# RENNSPORT AUTOMOTIVE

353 ADAMS STREET
BEDFORD HILLS, NY 10507
PHONE (914) 241-3338

**Invoice #:** 19593
**Service:** 12-18-2020
**Time:** 4:52:52 PM

[redacted]tt
[redacted]

**Phone:** [redacted]-
**Work:** - -

**Vehicle:** 1988 PORSCHE 911 **Vin:** WP0EB0918JS160158 **License** HX98365 **Miles:** 151,250

| Code | Qty. | Part Number | Description | Each Price | Total |
|---|---|---|---|---|---|
| 1 | 1 | 91164154102 | Oil Level Sender, in Sump Tank | 257.46 | 257.46 |
| 6 | 1 | FREIGHT | Freight | 20.00 | 20.00 |
| | | | **Subtotal for OIL LINE** | | **1,553.10** |
| 1 | 0.4 | Replace faulty engine lid support | | | 64.80 |
| 1 | 1 | 91151233100 | Deck Lid Strut | 51.33 | 51.33 |
| | | | **Subtotal for SHOCK** | | **116.13** |
| 1 | 1.5 | Replace rear targa seal | | | 243.00 |
| 1 | 1 | 911565091478V B | Targa Bar Seal | 524.39 | 524.39 |
| | | | **Subtotal for TARGA** | | **767.39** |
| 1 | 0.8 | Replace missing rear fender supports | | | 129.60 |
| 1 | 1 | 93050162801 | Support | 37.58 | 37.58 |
| 1 | 1 | 91150162801 | Support | 51.58 | 51.58 |
| | | | **Subtotal for SUPPORT** | | **218.76** |
| 1 | 0.4 | Found fog lamps not working. Clean corrode fuse and repair bad ground on left side fog lamp | | | 64.80 |
| | | | **Subtotal for FOG** | | **64.80** |
| 1 | 0.3 | Found right side windsield wash not working . Replace check valve | | | 48.60 |
| 1 | 1 | 91462843300 | Wiper Washer "T" One-Way Valve | 9.97 | 9.97 |
| | | | **Subtotal for WASHERS** | | **58.57** |
| 1 | 1 | 91155106705 | Climate Control Linkage Cover | 254.69 | 254.69 |
| 1 | 0.2 | Install missing climate control cover in trunk | | | 32.40 |
| | | | **Subtotal for COVER** | | **287.09** |
| 1 | 0.5 | Replace broken oil tank vent hose | | | 81.00 |
| 1 | 1 | 93020724301 | Rubber Sleeve | 6.91 | 6.91 |
| 4 | 1 | 99951255400 | Hose Clamp | 2.90 | 2.90 |
| 1 | 1 | 99951255201 | Hose Clamp | 2.90 | 2.90 |
| | | | **Subtotal for VENT** | | **93.71** |
| 1 | 1.5 | Replace brake fluid | | | 243.00 |
| 1 | 1 | BF41 | Brake fluid | 24.29 | 24.29 |
| | | | **Subtotal for BRAKE FLUI** | | **267.29** |
| 1 | 1.5 | Found parking brake cable on right side siezed into holding sleave. Remove, free up and lubricate. Adjust parking brake | | | 243.00 |
| | | | **Subtotal for PARKING** | | **243.00** |
| 1 | 1.2 | Clean corrosion off fuse panel and replace all fuses | | | 194.40 |
| 1 | 4 | 16AMP | 16 Amp Ceramic | 4.93 | 19.72 |
| 1 | 5 | 0005458234 | Fuse 8 Amp Ceramic | 3.07 | 15.35 |
| 0 | 6 | ATC5 | 5Amp Ceramic Fuse | 3.70 | 22.20 |
| 0 | 6 | 25AMP | 25 Amp Ceramic Fuse | 3.07 | 18.42 |
| | | | **Subtotal for FUSE** | | **270.09** |

**Service Invoice**

# RENNSPORT AUTOMOTIVE

353 ADAMS STREET
BEDFORD HILLS, NY 10507
PHONE (914) 241-3338

**Invoice #:** 19593
**Service:** 12-18-2020
**Time:** 4:52:52 PM

[redacted]t
[redacted]

**Phone:** [redacted]-
**Work:** - -

**Vehicle:** 1988 PORSCHE 911 **Vin:** WP0EB0918JS160158 **License** HX98365 **Miles:** 151,250

| Code | Qty. | Part Number | Description | Each Price | Total |
|---|---|---|---|---|---|

**Recommended Services**

**Recommended AC**

Check A/C . Found blower for condenser not working. Needs new blower. System has no refrigerent . Needs Compressor and filter drier compressor leaking — 81.00

**Estimate for AC** — **81.00**

**Payments**

I hereby authorize the repair work herein set forth to be done by you, together with the furnishing by you of the necessary parts and other material for such repair, and agree: that you are not responsible for any delays caused by unavailability or delayed availability of parts and material for any reason: that you neither assume nor authorize any other person to assume for you any liability in connection with such repair; that you shall not be responsible for loss of or damage to the above vehicle, or articles left therein; in case of fire, theft or other cause beyond your control; that an express mechanic's lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto; that your employees may operate the above vehicle on streets, highways or elsewhere for purpose of testing and/or inspecting such vehicle.

[redacted]

[redacted]

| Department | Sale | Estimate |
|---|---|---|
| Labor | 4,293.00 | 81.00 |
| fuel | 0.00 | 0.00 |
| Towing | 0.00 | 0.00 |
| Parts | 3,736.30 | 0.00 |
| N.Y.State Inspection | 10.00 | 0.00 |
| Discount | 0.00 | 0.00 |
| Tire Disposal Fee | 0.00 | 0.00 |
| Shop Supplies | 0.00 | 0.00 |
| Discount | 0.00 | 0.00 |
| Enviro fees | 0.00 | 0.00 |
| SUB TOTAL ==> | 8,039.30 | 81.00 |
| Sales Tax | 672.86 | 6.79 |
| Tire Disposal Fee | 0.00 | 0.00 |
| **TOTAL ==>** | **8,712.16** | **87.79** |
| **Balance Due:** | **8,712.16** | |