This 2001 Porsche 996 Carrera Cabriolet is finished in rare Orient Red Metallic over a Graphite Grey interior and equipped with an optional 5-speed Tiptronic S automatic transmission. The car was further configured with 18" SportDesign wheels, Litronic headlights, Porsche Stability Management (PSM), heated 8-way power seats with memory, stainless steel tailpipes, and more. Benefiting from a recent major service and a replacement IMS bearing, and accompanied by a body-color removable hardtop, this Carrera Cabriolet is now being offered for auction in Massachusetts, showing approximately 70k miles on the odometer.

Finished in rare Orient Red Metallic (L8A3), this Cabriolet features a Graphite Grey power-operated soft top and is accompanied a body-color removable hardtop with a stand. Optional equipment includes Litronic (xenon) headlights with headlamp washers, colored Porsche-crested wheel center caps, Exclusive 18" SportDesign wheels, and Exclusive stainless steel tailpipes. It rides on new Pirelli P Zero AS3 tires from June 2026, measuring 225/40 up front and 265/35 at the rear. The seller notes a few small chips on the hood that are touched up annually, minor paint wear on a door trim piece, a small and barely noticeable depression on the right rear quarter panel, and a dime-size mark on the hardtop. Detailed images are provided in the gallery along with a clean CARFAX report.

The cabin is trimmed in Graphite Grey and was factory-optioned with heated 8-way power front seats with driver memory, a three-spoke steering wheel with Tiptronic shift buttons, an on-board computer, and a wind deflector. A double-DIN Kenwood head unit was installed in 2018 with a backup camera, Bluetooth, Apple CarPlay, and SiriusXM, and the original Becker CDR-220 radio is included in the sale. Anti-fog Vision vents were added in 2023. The seller notes a nick near the passenger airbag, slight wear on the softer side air-vent material, a missing passenger-seat fore/aft switch button (the seat operates normally), and a slight tear at the top of the windscreen.

Power comes from a 3.4-liter flat-six rated at 300 HP and 258 lb-ft of torque, driving the rear wheels through a 5-speed Tiptronic S automatic transmission. This example was optioned with Porsche Stability Management (PSM). A replacement IMS bearing was reportedly installed after the seller's 2014 purchase, and in July 2026 the car received approximately $8k in service, including replacement of the cam adjuster shoes, resealed cam covers, new motor mounts, axle seals, an air-oil separator (AOS), fender linings, and brake hoses, with the work covered by a 3-year/36,000-mile warranty from the performing shop. A brake-fluid flush was performed at 64,842 miles and a new battery at 64,880 miles. The seller reports that all service records are available.

This sale will include a clean title, owner's manuals, a spare tire, a car cover, a battery charger, a paint-chip repair kit, cleaning materials, two sets of keys, and the color-matched hardtop on its stand, along with race ramps and a trickle charger. With other odds and ends. The seller would like you to know:

I have owned this car for the past 14 years and stored it in my climate-controlled garage each winter, up on race ramps with a trickle charger and cover. It has new tires and special wheels, and everything works properly. The car has been very well taken care of since purchase, including a new IMS bearing, with regular service and an average of about 2,400 miles a year. It has no accidents and, even with the Tiptronic, has been a joy to drive, with shift controls on the wheel that I use all the time. Recent health issues make it time to part with it, even after the $8,000 I recently invested. The 996s are finally increasing in value, and even some collectors are now seeking them out. As an entry into Porsche ownership, you won't be disappointed. Best to ship car and hardtop together on its stand.

From Porsche 991.2 Maintenance Booklet

911 Carrera / Targa

Service	*911 Carrera / Targa*	Confirmed Last Date	Confirmed Last Mileage
Every 10k / 1 year			
	Every 10k / 1 year		
Drain engine oil	☑		
Replace oil filter	☑		
Fill engine oil	☑		
Check: Visual inspection of underbody panels	☑		
Check: Visual inspection for oil/fluid leaks from underneath	☑		
Check: Visual inspection of tires	☑		
Check: Visual inspection of brake *lines*	☑		
Check: Visual inspection of brake *hoses*	☑		
Reset maintenance interval	☑		

Incremental Service	*911 Carrera / Targa*	Confirmed Last Date	Confirmed Last Mileage
Every 20k / 2 year			
	Every 20k / 2 year		
Check: Windshield wiper/washer system	☑		
Check: Horn	☑		
Check: Tire pressure / TPMS	☑		
Check: Diagnostic system, faults	☑		
Check: Actuator travel of brake shoes	☑		
Check: Front lid (frunk) lock/safety hook	☑		
Check: Fluid level wiper/washer	☑		
Check: Wiper blades	☑		
Check: Headlight adjustment	☑		
Check: Visual inspection of radiators and air intakes contamination / blockage	☑		
Check: Brake pads / discs (no wheel removal)	☑		
Check: Visual inspection of drive shafts (check boots for leaks/damage)	☑		
Check: Coolant level and antifreeze	☑		
Check: PDCC fluid level	☑		
Check: Visual inspection for intercooler debris	☑		
Check: All interior switches, check function	☑		
Replace: Inside particle filter	☑		
Replace: Air Intake pre-filter in frunk	☑		
Replace: Brake fluid	2 year		
Check/Replace: Tire sealing compound	2 year		
Condition report for long-life guarantee	2 year		
Service/maintain: sunroof slide/tilt, convertible top, targa roof	☑		

Incremental Service	*911 Carrera / Targa*	Confirmed Last Date	Confirmed Last Mileage
Every 30k / 4 year			
	Every 30k / 4 year		
Replace spark plugs	☑		
Incremental Service	***911 Carrera / Targa***		
Every 40k / 4 year			
	Every 40k / 4 year		
Check: Seat Belts	☑		
Check: Door locks	☑		
Check: Brake pads / discs (wheel removal)	☑		
Check: Visual inspection of steering gear (bellows)	☑		
Check: Visual inspection of tie rod joints (check play and dust bellows)	☑		
Check: Axle joint play and inspect dust boots for damage	☑		
Check: Rear axle steering bellows, dust boots and play on joints	☑		
Check: Visual inspection of exhaust system for leaks / damage, engine mount	☑		
Check: Drive belt	☑		
Check: Visual inspection of fuel lines and conections	☑		
Replace: Air cleaner in engine compartment	☑		
Incremental Service	***911 Carrera / Targa***	Confirmed Last Date	Confirmed Last Mileage
Every 80k / 4 year			
	Every 80k / 4 year		
Check: Visual inspection of ancillary unit mounts and chassis (rubber mountings and boots for damage	☑		
Incremental Service	***911 Carrera / Targa***	Confirmed Last Date	Confirmed Last Mileage
Every 60k / 6 year			
	Every 60k / 6 year		
Change Oil: controlled all wheel drive system	☑		
Replace: PDCC reservoir	☑		
Replace: Drive belt	☑		
Incremental Service	***911 Carrera / Targa***	Confirmed Last Date	Confirmed Last Mileage
Every 120k / 12 year			
	Every 120k / 12 year		
Change Oil: front axle final drive	☑		
Change Oil: Manual transmission	☑		
Change Oil: PDK transmission	☑		
Change Oil: clutch fluid	☑		
Misc	***911 Carrera / Targa***	Confirmed Last Date	Confirmed Last Mileage
Battery replaced			
Tires			
Wiper blades			
Rear brake pads			
Front brake pads			



CDR 220
CR 220

PORSCHE

CARFAX Report US $49.99

2001 Porsche 911 Carrera

69,624 mi | **VIN:** WP0CA29901S651691

Convertible | 3.4L H6 F DOHC | Gasoline



NO ACCIDENTS REPORTED

No Accidents or Damage Reported to CARFAX

25 Service History Records

3 Previous Owners

Types of Owners: Personal Lease, Personal

Last Owned in Massachusetts

53 Detailed Records Available

This CARFAX Vehicle History Report is based only on information supplied to CARFAX and available as of 10/5/26 at 12:51:03 PM (CDT). Other information about this vehicle, including problems, may not have been reported to CARFAX. Use this report as one important tool, along with a vehicle inspection and test drive, to make a better decision about your next used car.

CARFAX Recent Service Highlights

Key services performed in the last 12 months

Service	Comments	Date
Oil	✓ Oil and filter changed	07/17/2026
Brakes	✓ Brake fluid flushed/changed	04/30/2026



This car has been recently serviced. That's a good thing!

CARFAX Additional History

Not all accidents / issues are reported to CARFAX

	Owner 1	Owner 2	Owner 3
Total Loss No total loss reported to CARFAX.	No Issues Reported	No Issues Reported	No Issues Reported
Structural Damage *No structural damage reported to CARFAX.*	No Issues Reported	No Issues Reported	No Issues Reported



Two states? Vehicle leasing companies often title a car in one state but register it to be driven in another.

11/06/2002	8,266	Blue Grass Automotive Louisville, KY 502-895-5295 bluegrassauto.com	**Vehicle serviced** - Oil and filter changed
11/08/2002	8,268	Maserati Alfa Romeo Louisville Louisville, KY 502-894-3426 bluegrassauto.com **4.7 / 5.0** 28 Verified Reviews	**Vehicle serviced** - Convertible top operation checked - Tire(s) balanced
03/26/2004	13,962	Blue Grass Automotive Louisville, KY 502-895-5295 bluegrassauto.com	**Vehicle serviced** - 15,000 mile service performed - Battery/charging system checked - Battery replaced - Drivability/performance checked - Fuel injection system flushed/serviced - Oil and filter changed
03/30/2004		Maserati Alfa Romeo Louisville Louisville, KY 502-894-3426 bluegrassauto.com **4.7 / 5.0** 28 Verified Reviews	**Vehicle serviced** - No-start/hard start condition checked
05/07/2004	14,602	Blue Grass Automotive Louisville, KY 502-895-5295 bluegrassauto.com	**Vehicle serviced**
05/07/2004		Maserati Alfa Romeo Louisville Louisville, KY 502-894-3426 bluegrassauto.com **4.7 / 5.0** 28 Verified Reviews	**Vehicle serviced** - Engine/powertrain computer/module checked
03/08/2005	18,478	Auto Auction	**Listed as a fleet vehicle** - Vehicle sold



Millions of used vehicles are bought and sold at auction every year.

03/21/2005	18,488	California Inspection Station Studio City, CA	**Passed emissions inspection**

Owner 2
Purchased: 2005



Low mileage! This owner drove less than the industry average of 15,000 miles per year.

Personal Vehicle
1,848 mi/yr

Date	Mileage	Source	Comments
04/08/2005	18,494	California Motor Vehicle Dept. La Quinta, CA	**Title issued or updated** - New owner reported
04/07/2007		California Inspection Station	**Passed emissions inspection**
04/07/2007	23,991	GNC Smog and Auto Repair Indio, CA 760-342-5888	**Vehicle serviced** - Emissions inspection performed

05/25/2016	44,271	New Country Porsche of Greenwich Greenwich, CT 203-869-8900 newcountry.com 4.6 / 5.0 86 Verified Reviews 54 Customer Favorites	**Vehicle serviced** - Maintenance inspection completed - Vehicle washed/detailed
08/15/2016	45,716	Massachusetts Inspection Station Plymouth, MA	**Passed safety inspection**
07/19/2017	48,999	Massachusetts Inspection Station Plymouth, MA	**Passed safety inspection**
04/17/2018	50,527	South Shore Autoworks Kingston, MA 781-585-5587 4.9 / 5.0 449 Verified Reviews 2,557 Customer Favorites	**Vehicle serviced** - Recommended maintenance performed - Alignment performed - Horn replaced
05/01/2018		Massachusetts Motor Vehicle Dept. Plymouth, MA Title #BN890514	**Registration issued or renewed** - Vehicle color noted as Red
06/05/2018	51,213	South Shore Autoworks Kingston, MA 781-585-5587 4.9 / 5.0 449 Verified Reviews 2,557 Customer Favorites	**Vehicle serviced** - Tire condition and pressure checked
07/09/2018	51,793	Massachusetts Inspection Station Plymouth, MA	**Passed safety inspection**
12/05/2018		South Shore Autoworks Kingston, MA 781-585-5587 4.9 / 5.0 449 Verified Reviews 2,557 Customer Favorites	**Vehicle serviced** - Drive belts checked - Serpentine belt replaced - Vehicle washed/detailed
07/22/2019	54,770	Massachusetts Inspection Station Plymouth, MA	**Passed safety inspection**
09/27/2019	55,852	South Shore Autoworks Kingston, MA 781-585-5587 4.9 / 5.0 449 Verified Reviews 2,557 Customer Favorites	**Vehicle serviced** - Recommended maintenance performed - Brake fluid flushed/changed - Wiper(s) replaced
05/01/2020		Massachusetts Motor Vehicle Dept. Plymouth, MA Title #BN890514	**Registration issued or renewed** - Vehicle color noted as Red
11/10/2020	58,085	South Shore Autoworks Kingston, MA 781-585-5587 4.9 / 5.0 449 Verified Reviews 2,557 Customer Favorites	**Vehicle serviced**
11/17/2021	59,909	South Shore Autoworks Kingston, MA 781-585-5587 https://southshoreautoworks.com/ 4.9 / 5.0 449 Verified Reviews	**Vehicle serviced** - Recommended maintenance performed - Air filter replaced - Drive belt(s) replaced - Engine checked - Fuel system checked

2,557 Customer Favorites

07/17/2026	69,624	South Shore Autoworks Kingston, MA 781-585-5587 southshoreautoworks.com/ **4.9 / 5.0** 449 Verified Reviews **2,557** Customer Favorites	**Vehicle serviced** - Engine mount(s) replaced - Oil and filter changed - Oil pump seal replaced - Timing chain gears replaced - Timing chain tensioner/guide replaced

Have Questions? Consumers, please visit our Help Center at www.carfax.com. Dealers or Subscribers, please visit our Help Center at www.carfaxonline.com.

CARFAX Glossary

First Owner
When the first owner(s) obtains a title from a Department of Motor Vehicles as proof of ownership.

New Owner Reported
When a vehicle is sold to a new owner, the Title must be transferred to the new owner(s) at a Department of Motor Vehicles.

Ownership History
CARFAX defines an owner as an individual or business that possesses and uses a vehicle. Not all title transactions represent changes in ownership. To provide estimated number of owners, CARFAX proprietary technology analyzes all the events in a vehicle history. Estimated ownership is available for vehicles manufactured after 1991 and titled solely in the US including Puerto Rico. Dealers sometimes opt to take ownership of a vehicle and are required to in the following states: Maine, Massachusetts, New Jersey, Ohio, Oklahoma, Pennsylvania and South Dakota. Please consider this as you review a vehicle's estimated ownership history.

Title Issued
A state issues a title to provide a vehicle owner with proof of ownership. Each title has a unique number. Each title or registration record on a CARFAX report does not necessarily indicate a change in ownership. In Canada, a registration and bill of sale are used as proof of ownership.

Follow Us: facebook.com/CARFAX @CARFAXinc **About CARFAX**

CARFAX DEPENDS ON ITS SOURCES FOR THE ACCURACY AND RELIABILITY OF ITS INFORMATION. THEREFORE, NO RESPONSIBILITY IS ASSUMED BY CARFAX OR ITS AGENTS FOR ERRORS OR OMISSIONS IN THIS REPORT. CARFAX FURTHER EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.

© 2026 CARFAX, Inc., part of S&P Global. All rights reserved.
10/5/26 12:51:03 PM (CDT)

SHOW ME THE CARFAX

I have reviewed and received a copy of the CARFAX Vehicle History Report for this 2001 PORSCHE 911 vehicle (VIN: WP0CA29901S651691), which is based on information supplied to CARFAX and available as of 10/5/26 at 1:51 PM (EDT).

Customer Signature **Date** **Dealer Signature** **Date**

Vehicle Specification

VIN: WP0CA29901S651691

2001 Porsche 911 Carrera 2dr Carrera Cabriolet

Model Year:	2001	**Body Type:**	Convertible
Division:	Porsche	**Market Class Name:**	2-door Mini-Compact Passenger Car
Model Name:	911 Carrera	**Manufacturer Identifier:**	Germany Porsche
Style and Trim:	2dr Carrera Cabriolet	**Driving Wheels:**	

Engine and Fuel

engine type:	Flat 6 Cylinder Eng	**hp value:**	300.0	**fuel type:**	Gasoline Fuel	**fuel economy city:**	16.0
cylinders:	6	**hp rpm:**	6800	**fuel tank capacity:**	16.9	**fuel economy hwy:**	24.0
displ liters:	3.4	**net torque value:**	258.0	**fuel tank capacity unit:**	gal	**fuel economy unit:**	MPG
displ cubic inch:	207	**net torque rpm:**	4600	**forced induction type:**			

Standard Equipment

EXTERIOR

- Color-keyed door handles
- Rear fog lights
- Pwr/heated color-keyed outside mirrors
- Tinted glass w/graduated tint windshield
- Integrated front fog lights
- Full pwr top w/automatic latching/unlatching
- Speed-dependent extendable rear spoiler w/integrated third brake light

INTERIOR

- Ignition key w/integrated remote control device
- 2 + 2 Seating
- Instrumentation-inc: analog & digital speedometer, analog tachometer, digital odometer/trip odometer
- Integrated central locking/alarm/immobilizer system w/remote entry
- Individually folding rear seat backs
- Infra-red interior guard
- Automatic climate control w/dust/odor filter
- Windshield antenna w/signal amplifier
- Dual illuminated visor vanity mirrors
- Orientation lights-inc: dash/center console, ignition lock, light switch, door releases
- Storage compartment behind rear seats
- Pwr engine lid release
- Leather covered 4-spoke tilt steering wheel
- Cruise control
- Pwr windows w/one-touch up/down, anti-jam feature
- Luggage compartment covered in black fleece

MECHANICAL

- Front/rear stabilizer bars
- Aluminum alloy multi-link LSA rear axle
- 16.9 gallon fuel tank
- 4-piston light alloy brake calipers
- 17" x 7.0" wheels (front)
- 17" x 9.0" wheels (rear)
- Aerodynamic drag-reducing under-carriage cover
- 120 amp alternator
- MacPerson strut front suspension w/aluminum alloy lower control arms
- VarioCam variable valve timing system
- 3.4L DOHC aluminum water-cooled horizontally-opposed 6 cyl engine
- Dual 3-way catalytic converters
- Fully integrated elect ignition/fuel injection systems
- Pwr 4-wheel ventilated/perforated disc brakes
- Force-sensitive pwr rack & pinion steering

SAFETY

- 3-point inertia-reel seatbelts for all seating positions
- Driver & front passenger airbags
- Front/rear crumple zones
- Brake pad wear indicators
- 4-wheel anti-lock braking system
- Door mounted side-impact airbags

On Jul 24, 2014, at 3:10 PM, Aaron Murphy <aaron@europeanautosurgeons.com> wrote:

Steven, We have reviewed your 2001 911 Cab and it has passed the pre qualification steps for installation of the IMS Solution. At your request we will get started on the procedure. ($3200) completed

A few other notes:

Brakes: Brake pads on all four wheels are currently 5.5-6mm thick (10mm new/ Replace @ 3mm)

Recommendations:

Replace air oil separator- These are a common failure and very difficult to change on convertible/tiptronic cars. This part will be easily accesses while we are performing the IMS solution ($225) completed

Waterpump/ Thermostat- The current water pump is original to the vehicle and is close it 15 years old. Waterpump failure can lead to catastrophic engine damage. We recommend replacing the water pump, thermostat (lower temp version), drive belt and engine coolant. ($800) completed

Ignition switch will need to be replaced ($200) completed

Please let me know how you would like to proceed

Aaron Murphy
European Auto Service
Gardiner, Maine
207.582.2302
www.easmaine.com

PACKING LIST

Ship On or Before

7/28/2014

PKG ID NO: **2046926**

Page 1 of 1

CUSTOMER NO: ECK327X
ORDER DATE: 7/24/2014

SHIP TO:
STEVEN EICHBERG
25 HICKORYWOOD
PLYMOUTH, MA 02360

NOTE: FLAT BOXES-PLASTIC

CUSTOMER P.O.	SHIP VIA	F.O.B.	LEG
61124995	FEDX GROUND	3RD	

ITEM NO.	DESCRIPTION	ORDERED	UNIT PRICE	TOTAL
3701230	PORSCHE-911(996)-CARRERA-2001/2005-(4) SB	1		
47604	VEL-2 FRNT & 2PC 2ND SEAT--PLAIN	1		
1966	GREY-VT	1		
DS	DROP SHIP	1		



EUROPEAN AUTO SERVICE

We Have The Technology | We Have The Experience

PO Box 115
207 582-2302

Gardiner, ME 04345
www.easmaine.com

Inv # 0012020 Writer: AARON MURPHY

Customer : EICHBERG, STEVEN
Address : 25 HICKORYWOOD
City : PLYMOUTH, MA 02360-
Phone 1 : (508)224-6718 Ext:
Phone 2 : (914)329-6057 Ext:

Vehicle : 2001 PORS 911 C2 CAB
License : 5MMY744 Date : 8/12/14
VIN : WP0CA29901S651691 Page : Page 1 of 2
Engine : 3.4 Trans : TIPTRONIC
Mileage : 35562 PO # :

Mfg date 6/2014

Tech	Labor Description / Qty	Part Number	Part Description	Labor	Part	Subtotal
FMB	Perform dual row Gen 2 IMS retrofit. Remove transmission, replace rear main seal and case bolts, remove sump plate and inspect, Install IMS retrofit bearing (serial #IMSR13100) and spin on oil filter adapter, Reassemble engine, fill and bleed cooling system, fill engine with break in oil, road test 75 miles and drain engine oil, refill with DT40 engine oil.			1232.00	1275.23	2507.23
	3.50		COOLANT, PORSCHE		105.00	
	3.50		COOLNT DISP FEE		3.50	
	1.00		OIL FILTER ADAPTER		180.93	
	10.00		GIBBS BREAK IN OIL		128.50	
	2.00		OIL FILTER, SPIN ON		10.74	
	1.00		FUEL,91		40.00	
	1.00		INTERMEDIATE BEARING KIT		650.00	
	10.00		JOE GIBBS DT40 ENGINE OIL		120.00	
	1.00		MAGNETIC DRAIN PLUG		36.56	
FMB	Customer has authorized prevantive replacement of waterpump, drive belt, thermostat and air/ oil seperator. Labor discounted with above repairs			264.00	756.89	1020.89
	1.00		BELT, PORSCHE		57.01	
	1.00		OIL SEPARATOR HOSE CLAMP		2.00	
	1.00		OIL SEPARATOR BOOT		19.64	
	1.00		WP GASKET		15.00	
	1.00		THERMOSTAT		80.00	
	1.00		WATER PUMP		389.49	
	1.00		OIL SEPARATOR		193.75	
FMB	Upon removal of transmission, tech noted transmission mount was torn. Remove transmission mount housing and press in replacement mount (with transmission removed)			70.40	55.00	125.40
	1.00		TRANSMISSION MOUNT		55.00	
AM	Check ignition switch- sticky. Tech replaced electrical portion of ignition switch			105.60	44.74	150.34
	1.00		IGNITION SWITCH		44.74	
AM	Brake inspection- was told it needs pads replaced. All brakes are at approx 6mm of pad thickness left			17.60		17.60
AM	Remove hardtop, check soft top operation-OK. Noted soft top rear window has been repaired substandardly (wrinkle, silicone sealant). Tested correct operation of all interior switches, HVAC, radio (called dealer for code #0869), exterior lights			61.60		61.60
AM	TECHNICIAN NOTES: Vehicle was delivered via transport from California. Vehicle is missing manuals and tool kit			0.00		



EUROPEAN AUTO SERVICE

We Have The Technology | We Have The Experience

PO Box 115
207 582-2302

Gardiner, ME 04345
www.easmaine.com

Inv # 0012020 Writer: AARON MURPHY

Customer : EICHBERG, STEVEN
Address : 25 HICKORYWOOD
City : PLYMOUTH, MA 02360-
Phone 1 : (508)224-6718 Ext:
Phone 2 : (914)329-6057 Ext:

Vehicle : 2001 PORS 911 C2 CAB
License : 5MMY744
VIN : WP0CA29901S651691
Engine : 3.4
Mileage : 35562

Date : 8/12/14
Page : Page 2 of 2
Trans : TIPTRONIC
PO # :

Tech	Labor Description / Qty	Part Number	Part Description	Labor	Part	Subtotal

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.WARRANTY IS 12 MONTHS OR 12,000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

X_____

Labor :	$1,751.20
Parts :	$2,128.36
Sublet :	$0.00
Other Fees :	$3.50
Supply Charges :	$37.82
Subtotal :	$3,920.88
Sales Tax :	$119.14
Total :	$4,040.02
By : Ref :	
Paid :	$0.00
Due :	$4,040.02

Signature X _____

04/27/2015

Levis And Sons Gulf @ The Pinehills

2 Purchase St
Plymouth, MA 02360
774-773-9160
Levisandsonsgulf.com

Invoice #4985

2001 PORSCHE 911

Tag:
ID:

Mileage 39,052

Labor	Amount
CHANGE OIL AND FILTER	$30.00
	$30.00

Part No.	Parts	Quantity	Each	
	OIL FILTER	1.00		$29.95
				$29.95

Subtotal	**$59.95**
Tax	$1.87
Total	**$61.82**

DATE_____ SIGNED_____

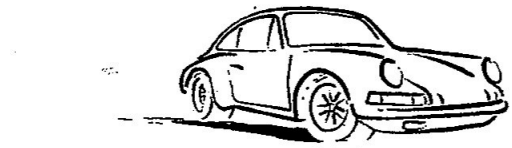

DA-WERKS.com
508.747.2314

Invoice

DATE	INVOICE #
6/25/2015	2982

BILL TO	SHIP TO
steven eichberg miles out 41,332	same

P.O. NO.	TERMS	PROJECT
se	Due on receipt	

QUANTITY	DESCRIPTION	AMOUNT
1	2001 Porsche c2 cabriolet...client cites steering wheel horn & alarm horn not working...performed car brain/ecu scan & no relevant codes found...brain cleared of any & all codes	150.00T
1	brake service: replace all brake pads, rotors, sensors, flush & replace brake fluid...parts...(hdwr kit looked ok to reuse)	1,140.00T
1	labor for brake work	475.00
1	cooling system service: replace expansion tank, tank cap, antifreeze removed...parts $360 + antifreeze $130.00...	490.00T
1	labor for cooling sys work...	275.00
1	replace engine air filter & cabin air filter...	64.00T
1	alarm horn & steering wheel horn repairs...alarm horn 24...	24.00T
1	labor...0.5 hrs...	35.00
1	overnite ship horn	35.00
1	convertible top service: wash, clean and fabric treat convertible top fabric for water repellency & protection from sun...	150.00
1	passenger retractable seat belt ripped...part replaced...part...	175.00T
1	labor...1.5 hrs @ $65/hr = $97.50	75.00
1	overnite ship seatbelt	35.00
1	replace engine spark plugs...parts	58.00T
1	labor...2.5 hrs @ $65/hr = $163.00...	150.00
1	replace fuel filter...part...	49.00T
1	labor...1.25 hrs @ $65/hr = $82.00...	75.00
	Sales Tax	134.38

Thank you Steve...enjoy the great car...!! Bob

Total $3,589.38

DA-WERKS

5 Knoll Road
Plymouth, MA 02360

Vehicle Location & PPI
Enclosed trailer for transport
Everything from routine service to rebuilds

4/27/17 Steve Eichberg 2001 Porsche 996 Cab

miles in 47,799 ... miles out 47,810

1. oil & Filter change $280.00
2. add ½ gal. anti freeze 30.00
4. tires @: F 38/39 R 39/40 PSI
tires set to spec F/36 R/44 PSI
5. Scan Bain for any codes ($250) 100.00
codes found: Cow. Top, Litronic Headlights
codes cleared...
6. Spare tire @ 30... set to spec 60PSI
7. lubed doors & lids & locks...
8. overall maintenance check per attached... 30.00

$460.00

Thank you!

South Shore Autoworks, LLC

Invoice #0006596 4/17/2018 5:00 pm

2001 PORSCHE 911 SERIES
6-3436 3.4L DOHC
VIN : WP0CA29901S651691
Mileage : 50527
Trans :
License : PL1124

Your Service Writer Today Is: CASEY Center: RETAIL

Service Requests:

Category Summary	Parts	Labor	Job Total
Miscellaneous	$141.49	$297.00	$438.49
PORSCHE	$71.25	$327.75	$399.00
WHEEL ALIGNMENT	$0.00	$247.50	$247.50

Technician	Service Description					Parts	Labor	Job Total
AND	PORSCHE ALIGNMENT						247.50	247.50
AND	REPLACE HORNS					141.49	297.00	438.49
	Part Number	Part Description	Part Price Each	Quantity	Extended			
S	996 635 205 07	Horn	43.02	1	43.02			
S	996 635 206 07	Horn	43.02	1	43.02			
S	996-631-045-01	HEADLIGHT CORNER TRIM	55.45	1	55.45			
AND	PORSCHE ANNUAL SERVICE					71.25	327.75	399.00
	Part Number	Part Description	Part Price Each	Quantity	Extended			
S	1042	NAPAGOLD OIL FILTER	16.68	1	16.68			
S	996 107 225 53	OX128 OIL FILTER	26.39	1	26.39			
S	996 572 219 02	CABIN FILTER CHARC	28.18	1	28.18			

Services Recommended to Customer
REPLACE CENTER CONSOLE

Parts Recommended To Customer

1	996-552-125-03-C53	CENTER CONSOLE
1	996-552-089-05-C53	TRIM
1	996-552-283-02-C53	CONSOLE COVER
1	996-424-031-12-EUL	PARKING BRAKE LE
1	996-454-155-01-C53	HAND BRAKE TRIM

Payments:
VISA, $1098.29, on 04/17/18
CardNo: [********6818], AuthorizationNo: [08408I]**

4/17/2018 4:59:46 PM Auth 08408I Ref SUCCESS

$ 1,098.29 Agrees to Pay Total Amount According to
VISA **********6818 Card Issuer Agreement Signature X

Repair Order Notes

WARRANTY INFORMATION

All other products and workmanship are warranted for 12 months or 12000 miles from the date of installation. All parts shown are new unless otherwise specified. I hereby authorize you and/or your agents to contact me regarding the products and services provided. An express mechanic's lien is hereby granted. I acknowledge receipt of a copy of this repair order.

Thank you for your business!

A1 Auto Upholstery

Customer Signature: _____ Date: _____

TOTAL PARTS	$212.74
TOTAL LABOR	$872.25
SUBLET	$0.00
	$0.00
SUBTOTAL	$1,084.99
OTHER FEES	$0.00
SALES TAX	$13.30
INVOICE TOTAL	**$1,098.29**
PAID	$1,098.29
DUE	$0.00

South Shore Autoworks, LLC

Invoice #0006872 6/5/2018 3:22 pm

2001 PORSCHE 911 SERIES
6-3436 3.4L DOHC
VIN : WP0CA29901S651691
Mileage : 51213
Trans :
License : PL1124

Your Service Writer Today Is: WAYNE Center: RETAIL

Service Requests:

Category Summary	Parts	Labor	Job Total
PORSCHE	$0.00	$297.00	$297.00

Technician	Service Description	Parts	Labor	Job Total
AND	CUSTOMER SUPPLIED CONSOLE AND AND TRIM ALSO PHONE CRADLE CAN BE REINSTALLED INSTALLED AND SWAPPED OVER PIECES TO NEW CONSOLE REVIEWED WITH CUSTOMER		297.00	297.00
AND	CHECK TIRE PRESSURES RESET TIRE PRESSURES		0.00	

Payments:
VISA, $297.00, on 06/05/18
CardNo: [********6683], AuthorizationNo: [031565]**

6/5/2018 3:21:56 PM Auth 031565 Ref SUCCESS

$ 297.00 Agrees to Pay Total Amount According to
VISA **********6683 Card Issuer Agreement Signature X

Repair Order Notes

WARRANTY INFORMATION

All other products and workmanship are warranted for 12 months or 12000 miles from the date of installation. All parts shown are new unless otherwise specified. I hereby authorize you and/or your agents to contact me regarding the products and services provided. An express mechanic's lien is hereby granted. I acknowledge receipt of a copy of this repair order.

Thank you for your business!

Customer Signature: _____ Date: _____

TOTAL PARTS	$0.00
TOTAL LABOR	$297.00
SUBLET	$0.00
	$0.00
SUBTOTAL	$297.00
OTHER FEES	$0.00
SALES TAX	$0.00
INVOICE TOTAL	**$297.00**
PAID	$297.00
DUE	$0.00

South Shore Autoworks, LLC

Invoice #0008038 12/5/2018 1:05 pm

2001 PORSCHE 911 SERIES
6-3436 3.4L DOHC
VIN : WP0CA29901S651691
Mileage : 50527
Trans : AUTO
License : PL1124

52,000

Your Service Writer Today Is: WAYNE Center: RETAIL

Service Requests:

Category Summary	Parts	Labor	Job Total
ENGINE	$57.43	$157.50	$214.93
PORSCHE	$343.05	$483.95	$827.00

Technician	Service Description	Parts	Labor	Job Total
AND	pass window rattles and window goes out side of top remove inner door panel checked operation found rattle noises coming front window regulator remove and replace window regulator and adjust to Porsche specs	283.32	262.50	545.82

	Part Number	Part Description	Part Price Each	Quantity	Extended
S	996 542 076 04	Window Regulator	283.32	1	283.32

Technician	Service Description	Parts	Labor	Job Total
AND	check belts and hoses heard noise from belt replace serpentine belt	57.43	157.50	214.93

	Part Number	Part Description	Part Price Each	Quantity	Extended
S	6PK-2115	Drive Belt Multi-Rib	57.43	1	57.43

Technician	Service Description	Parts	Labor	Job Total
AND	perform a full detail		189.95	189.95
	Replace hatch strut	59.73	31.50	91.23

	Part Number	Part Description	Part Price Each	Quantity	Extended
S	996 512 551 03	Hatch Strut	59.73	1	59.73

Payments:
VISA, $1066.96, on 12/05/18
CardNo: [********1740], AuthorizationNo: [02133D]**

12/5/2018 1:04:04 PM Auth 02133D Ref SUCCESS

$ 1,066.96 Agrees to Pay Total Amount According to
VISA **********1740 Card Issuer Agreement Signature X

Repair Order Notes

WARRANTY INFORMATION

All other products and workmanship are warranted for 12 months or 12000 miles from the date of installation. All parts shown are new unless otherwise specified. I hereby authorize you and/or your agents to contact me regarding the products and services provided. An express mechanic's lien is hereby granted. I acknowledge receipt of a copy of this repair order.

Thank you for your business!

Customer Signature: _____ Date: _____

TOTAL PARTS	$400.48
TOTAL LABOR	$641.45
SUBLET	$0.00
	$0.00
SUBTOTAL	$1,041.93
OTHER FEES	$0.00
SALES TAX	$25.03
INVOICE TOTAL	**$1,066.96**
PAID	$1,066.96
DUE	$0.00

South Shore Autoworks, LLC

Invoice #0009574 9/5/2019 1:31 pm

2009 MINI COOPER
4-1598 1.6L DOHC
VIN : WMWMF73599TT96597
Mileage : 52814
Trans :
License : 5GLD80

Your Service Writer Today Is: WAYNE Center: RETAIL

Service Requests:

Category Summary	Parts	Labor	Job Total
ENGINE	$0.00	$45.00	$45.00

Technician	Service Description	Parts	Labor	Job Total
CHR	customer states noise during start up up and a noise from rear of car when driving lower engine mount under engine loose retighten found outer case of front exhaust pipe cracked but not leaking at this time		45.00	45.00

Payments:
VISA, $45.00, on 09/05/19
CardNo: [**********7097], AuthorizationNo: [00377I]

9/5/2019 12:30:12 PM Auth 00377I Ref SUCCESS

$ 45.00 Agrees to Pay Total Amount According to
VISA **********7097 Card Issuer Agreement Signature X

Repair Order Notes

WARRANTY INFORMATION

All other products and workmanship are warranted for 12 months or 12000 miles from the date of installation. All parts shown are new unless otherwise specified. I hereby authorize you and/or your agents to contact me regarding the products and services provided. An express mechanic's lien is hereby granted. I acknowledge receipt of a copy of this repair order.

Thank you for your business!

Customer Signature: _____ Date: _____

TOTAL PARTS	$0.00
TOTAL LABOR	$45.00
SUBLET	$0.00
	$0.00
SUBTOTAL	$45.00
OTHER FEES	$0.00
SALES TAX	$0.00
INVOICE TOTAL	**$45.00**
PAID	$45.00
DUE	$0.00

South Shore Autoworks, LLC

Invoice #0009675 9/27/2019 1:34 pm

2001 PORSCHE 911 SERIES
6-3436 3.4L DOHC
VIN : WP0CA29901S651691
Mileage : 55852
Trans : AUTO
License : PL1124

Your Service Writer Today Is: WAYNE Center: RETAIL

Service Requests:

Category Summary	Parts	Labor	Job Total
BRAKE SYSTEM	$24.95	$119.00	$143.95
PORSCHE	$134.06	$321.30	$455.36
TIRE	$0.00	$0.00	$0.00
WIPERS BLADES	$44.34	$0.00	$44.34

Technician	Service Description					Parts	Labor	Job Total
AND	PORSCHE ANNUAL SERVICE					134.06	321.30	455.36
	Part Number	Part Description		Part Price Each	Quantity	Extended		
S	1042	OIL FILTER		21.52	1	21.52		
S	996 572 219 02	CABIN FILTER CHARC		22.99	1	22.99		
S	0W-40	MOBIL 1 0W-40		9.95	9	89.55		
AND	BRAKE FLUSH					24.95	119.00	143.95
	Part Number	Part Description		Part Price Each	Quantity	Extended		
S	BF 1 200	BRAKE FLUID TYPE 200		24.95	1	24.95		
AND	[redacted]						0.00	
AND	Wiper Blade Install.					44.34	0.00	44.34
	Part Number	Part Description		Part Price Each	Quantity	Extended		
S	3 397 001 582	WIPER BLADE SET OE S		44.34	1	44.34		

Payments:
VISA, $656.36, on 09/27/19
CardNo: [********7097], AuthorizationNo: [00433I]**

9/27/2019 1:33:47 PM Auth 00433I Ref SUCCESS _____

$ 656.36 Agrees to Pay Total Amount According to
VISA **********7097 Card Issuer Agreement Signature X _____

Repair Order Notes

WARRANTY INFORMATION

All other products and workmanship are warranted for 12 months or 12000 miles from the date of installation. All parts shown are new unless otherwise specified. I hereby authorize you and/or your agents to contact me regarding the products and services provided. An express mechanic's lien is hereby granted. I acknowledge receipt of a copy of this repair order.

Thank you for your business!

_____

Customer Signature: _ Date: _____

TOTAL PARTS	$203.35
TOTAL LABOR	$440.30
SUBLET	$0.00
	$0.00
SUBTOTAL	$643.65
OTHER FEES	$0.00
SALES TAX	$12.71
INVOICE TOTAL	**$656.36**
PAID	$656.36
DUE	$0.00

MICROBLEND ENTERPRISES, INC
88 CAMELOT DRIVE, UNIT #34
PLYMOUTH, MA 02360 US
508 747 9818
microblend@yahoo.com

Invoice

PD chk 5484

MICRO BLEND
The Body Shop Alternative .net

INVOICE #	DATE	TOTAL DUE	ENCLOSED
7110	10/28/2019	$350.00	

DATE	DESCRIPTION	AMOUNT
10/28/2019	2001 PORSHE 911- RED.REPAIR LEFT FRONT BUMPER.	350.00

BALANCE DUE **$350.00**

South Shore Autoworks, LLC

Invoice #0011854 11/10/2020 1:52 pm

2001 PORSCHE 911 SERIES
6-3436 3.4L DOHC
VIN : WP0CA29901S651691
Mileage : In 58084 Out 58085
Trans : AUTO
License : PL1124

Your Service Writer Today Is: WAYNE Center: RETAIL

Service Requests:
Service Requests:
right side of top jammed it is down

Category Summary	Parts	Labor	Job Total
ENGINE	$39.90	$124.00	$163.90
PORSCHE	$0.00	$496.00	$496.00

Technician	Service Description	Parts	Labor	Job Total
	Mileage In: 58084 Mileage Out: 58085			
AND	customer states top will not go up noise from pass side remopve side panme; on right rear found linkage seperated from hydrulic pistomn /mounting stud came out of piston / cleaned and repaired threads found stud reinstalled and reattached top linkage (note cleared body drain while there)checked operation /top now working (NOTE WINDSRCEEN DAMAGED)		496.00	496.00
AND	REPLACE POLLEN FILTER DUE TO MICE CLEANED OUT NEST AND DEBRIS CLEARE PLENUM DRAINS AS WELL	39.90	124.00	163.90
S	*CABIN FILTER* *39.90* *1* *39.90*			

Services Recommended to Customer
EST 921.58 REPLACE BRAKE HOSES AND FLUSH SYSTEM

Parts Recommended To Customer

1	*BF 1 200*	*BRAKE FLUID TYPE 200*
4	*996 355 139 03*	*BRAKE HOSE*

Payments:
VISA, $667.39, on 11/10/20
CardNo: [**********6683], AuthorizationNo: [065900]

11/10/2020 1:52:00 PM Auth 065900 Ref SUCCESS

$ 667.39 Agrees to Pay Total Amount According to
VISA **********6683 Card Issuer Agreement Signature X

Repair Order Notes

WARRANTY INFORMATION

All other products and workmanship are warranted for 12 months or 12000 miles from the date of installation. All parts shown are new unless otherwise specified. I hereby authorize you and/or your agents to contact me regarding the products and services provided. An express mechanic's lien is hereby granted. I acknowledge receipt of a copy of this repair order.
All estimates and quotes are valid for 90 days from the date of this repair order.

Thank you for your business!

Customer Signature: Date:

TOTAL PARTS	$39.90
TOTAL LABOR	$620.00
SUBLET	$0.00
Shop Supply	$5.00
SUBTOTAL	$664.90
OTHER FEES	$0.00
SALES TAX	$2.49
INVOICE TOTAL	**$667.39**
PAID	$667.39
DUE	$0.00

South Shore Autoworks
192 Summer Street
Kingston, MA 02364
(781) 585-5587
wayne@southshoreautoworks.com
http://www.southshoreautoworks.com

Invoice for RO #13811

Service Advisor: Wayne Cahill
Posted Date: 11/17/21 at 03:38 PM EST
Client: STEVEN EICHBERG
Vehicle: 2001 Porsche 911 Carrera

	2001 Porsche 911 Carrera 3.4L 6Cyl GAS **9601 Naturally Aspirated** VIN: WP0CA29901S651691 License: PL1124 Color: N/A Odometer In: 59907 / Out: 59909	RO #13811 Time-In: 11/15/21 at 07:02 AM EST Save Parts: No

Client concerns:

- 60K SERVICE CHECK OVER FIRST

1 - 60K SERVICE CHECK OVER FIRST — TECH: A Grignon

Labor:			$75.00

✓ Approved on 11/15/21 at 07:04 AM EST — **$75.00**

2 - PORSCHE ANNUAL SERVICE — TECH: A Grignon

Labor:	PERFORM ANNUAL SERVICE		$351.00
Parts:	MOBIL 1 0W-40	9	$98.55
	GASKET RING	1	$1.99
	CABIN FILTER CHARC	1	$39.95
	OIL FILTER KIT W/ O-	1	$20.30

✓ Approved on 11/15/21 at 10:31 AM EST — *Subtotal $511.79 + est. Tax $10.05* — **$521.84**

3 - IGNITION — TECH: A Grignon

Labor:	REPLACE SPARK PLUGS AND IGNITION COILS		$390.00
Parts:	BER Direct Ignition Coil SEE BULLETIN !!	6	$525.84
	BER Spark Plug	6	$185.64

✓ Approved on 11/15/21 at 10:31 AM EST — *Subtotal $1,101.48 + est. Tax $44.47* — **$1,145.95**

4 - ENGINE — TECH: A Grignon

Labor:	REPLACE ENGINE AIR FILTER		$65.00
Part:	HEN Air Filter	1	$51.10

✓ Approved on 11/15/21 at 10:31 AM EST — *Subtotal $116.10 + est. Tax $3.19* — **$119.29**

5 - FUEL SYSTEM — TECH: A Grignon

Labor:	REPLACE FUEL FILTER		$195.00
Part:	MAH Fuel Filter	1	$90.28

✓ Approved on 11/15/21 at 10:31 AM EST — *Subtotal $285.28 + est. Tax $5.64* — **$290.92**

6 - ENGINE — TECH: A Grignon

Labor:	REPLACE DRIVE BELT		$65.00
Part:	CON Drive Belt	1	$58.79

✓ Approved on 11/15/21 at 10:31 AM EST — *Subtotal $123.79 + est. Tax $3.67* — **$127.46**

All other products and workmanship are warranteed for 12 months or 12,000 milesfrom the date of installation. All parts are new unless otherwise specified. I hereby authorize you and/or your agents to contact me regarding the products and ervices provided. An express mechanic's lein is hereby granted. I acknowledge receipt of a copy of this repair order. All estimates and quotes are valid for 90 days from the date of this repair order.

Thank you for your business!

South Shore Autoworks
192 Summer Street
Kingston, MA 02364
(781) 585-5587
wayne@southshoreautoworks.com
http://www.southshoreautoworks.com

Invoice for RO #16649

Service Advisor: Wayne Cahill
Date Created: 03/28/23 at 07:00 AM EDT
Client: STEVEN EICHBERG
Vehicle: 2001 Porsche 911 Carrera

	2001 Porsche 911 Carrera 3.4L 6Cyl GAS 9601 Naturally Aspirated VIN: WP0CA29901S651691 License: PL1124 Color: N/A Odometer In: 62211 / Out: 62213	**RO #16649** Time-In: 03/28/23 at 07:00 AM EDT Save Parts: No

Client concerns:

-
-
- lof
- ssa
- loaner

1 - 01 SSA Free Multi-Point Inspection — TECH: A Grignon

Labor:	SSA Free Multi-Point Inspection		
✓ Approved on 03/28/23 at 07:02 AM EDT		*0*	**0**

2 - 05 PORSCHE OIL CHANGE — TECH: A Grignon

Labor:	OIL CHANGE		
Parts:	MOBIL 1 0W-40		9
	GASKET RING		1
	OIL FILTER KIT W/ O-		1
✓ Approved on 03/28/23 at 07:02 AM EDT		*Subtotal $332.34 + est. Tax $8.12*	**$340.46**

3 - loaner — TECH: A Grignon

✓ Approved on 03/28/23 at 07:02 AM EDT		*0*	**0**

4 - New Job — TECH: A Grignon

Labor:	LONGER KNOB FELL OF PASS SEAT SWITCH		
✓ Approved on 03/28/23 at 07:03 AM EDT		*0*	**0**

All other products and workmanship are warranteed for 24 months or 24,000 milesfrom the date of installation. All parts are new unless otherwise specified. I hereby authorize you and/or your agents to contact me regarding the products and ervices provided. An express mechanic's lein is hereby granted. I acknowledge receipt of a copy of this repair order. All estimates and quotes are valid for 90 days from the date of this repair order.

Thank you for your business!

South Shore Autoworks
192 Summer Street
Kingston, MA 02364
(781) 585-5587
wayne@southshoreautoworks.com
http://www.southshoreautoworks.com

Invoice for RO #19696

Service Advisor: Wayne Cahill
Date Created: 02/21/24 at 02:41 PM EST
Client: STEVEN EICHBERG
Vehicle: 2001 Porsche 911 Carrera

	2001 Porsche 911 Carrera 3.4L 6Cyl GAS 9601 Naturally Aspirated VIN: WP0CA29901S651691 License: PL1124 Color: N/A Odometer In: 64838 / Out: 64842	RO #19696 Time-In: 02/21/24 at 02:41 PM EST Save Parts: No

0

Client concerns:

- ssa porsche oil change the convertible top does not raise from the dash switch.
- has the tax check 51.27

1 - 01 SSA Free Multi-Point Inspection — TECH: A G

Labor:	SSA Free Multi-Point Inspection	

✓ Approved on 02/21/24 at 02:43 PM EST — 0 — 0

2 - 04 PORSCHE OIL CHANGE — TECH: A G

Labor:	OIL CHANGE	
Parts:	MOBIL 1 0W-40	9
	GASKET RING	1
	OIL FILTER	1

✓ Approved on 02/21/24 at 02:43 PM EST — *Subtotal $364.54 + est. Tax $8.72* — **$373.26**

3 - the convertible top does not raise from the dash switch. — TECH: A G

Labor:

✓ Approved on 02/21/24 at 02:43 PM EST — **$150.00**

4 - ssa porsche oil change the convertible top does not raise from the dash switch. — TECH: A G

Note: parking brake switch 2.1hr

Labor:	REPLACE PARKING BRAKE SWITCH	
Part:	OES Brake Light Switch Parking Brake Warning	1

✓ Approved on 02/21/24 at 04:23 PM EST — *Subtotal $385.00 + est. Tax $4.38* — **$389.38**

5 - BRAKE - FLUSH — TECH: A G

Labor:	PERFORM BRAKE SYSTEM FLUID SERVICE	
Part:	ATE SL6 BRAKE FLUID	1

✓ Approved on 02/21/24 at 04:23 PM EST — *Subtotal $180.00 + est. Tax $1.88* — **$181.88**

6 - WIPER BLADE — TECH: A G

Labor:	REMOVE AND REPLACE WIPER BLADES	
Part:	BOS Window Wiper Blade Set 550mm/530mm	1

✓ Approved on 02/21/24 at 04:23 PM EST — *Subtotal $104.35 + est. Tax $4.65* — **$109.00**

All other products and workmanship are warranteed for 24 months or 24,000 milesfrom the date of installation. All parts are new unless otherwise specified. I hereby authorize you and/or your agents to contact me regarding the products and ervices provided. An express mechanic's lein is hereby granted. I acknowledge receipt of a copy of this repair order. All estimates and quotes are valid for 90 days from the date of this repair order.

Thank you for your business!

South Shore Autoworks
192 Summer Street
Kingston, MA 02364
(781) 585-5587
wayne@southshoreautoworks.com
http://www.southshoreautoworks.com

Invoice for RO #19982

Service Advisor: Dennis Burke
Date Created: 03/19/24 at 07:43 AM EDT
Client: STEVEN EICHBERG
Vehicle: 2001 Porsche 911 Carrera

[redacted]	2001 Porsche 911 Carrera 3.4L 6Cyl GAS 9601 Naturally Aspirated VIN: WP0CA29901S651691 License: PL1124 Color: Red Odometer In: 64879 / Out: 64880	RO #19982 Time-In: 03/19/24 at 07:43 AM EDT Save Parts: No

[redacted] bring in tomorrow morning, tuesday, and sit with [redacted] the seatbelt bell issue that was not there when you fixed [redacted] top issue. Is this possible?

1 - 02 SSA Safety Inspection			TECH: C H
Labor:	SSA Safety Inspection		
✓ Approved on 03/19/24 at 07:48 AM EDT		0	0

2 THE CUSTOMER STATES SINCE WE REPLACED THE PARK BRAKE SWITCH WHEN HE DRIVE WITH THE SEAT BELT ON AND TURNS - LEFT OR RIGHT THE SEAT BELT WARNING COMES ON.			TECH: C H
✓ Approved on 03/19/24 at 07:48 AM EDT		0	0

3 - PLEASE TEST THE BATTERY THE C/S HE HAS HAD IT FOR A LONG TIME			TECH: C H
Labor:			
Part:	INTERSTATE BATTERY	1	
✓ Approved on 03/19/24 at 07:48 AM EDT		*Subtotal $364.95 + est. Tax $13.43*	**$378.38**

RO Discounts			
Discount:	CHECK		-$52.17
		Subtotal	**-$52.17**

All other products and workmanship are warranteed for 24 months or 24,000 milesfrom the date of installation. All parts are new unless otherwise specified. I hereby authorize you and/or your agents to contact me regarding the products and ervices provided. An express mechanic's lein is hereby granted. I acknowledge receipt of a copy of this repair order. All estimates and quotes are valid for 90 days from the date of this repair order.

Thank you for your business!

SSA European Auto Repair
192 Summer Street
Kingston, MA 02364
(781) 585-5587
service@ssaeuro.com
http://www.ssaeuro.com

Invoice for RO #23696

Service Advisor: Sean Lunny
Posted Date: 01/16/25 at 02:26 PM EST
Client: STEVEN EICHBERG
Vehicle: 2001 Porsche 911 Carrera

	2001 Porsche 911 Carrera 3.4L 6Cyl GAS 9601 Naturally Aspirated VIN: WP0CA29901S651691 License: PL1124 Color: Red Odometer In: 67045 / Out: 67051	**RO # 23696** Time-In: 01/15/25 at 10:01 AM EST Promised Time-Out: 01/15/25 at 03:00 PM EST Save Parts: No

1 - 01 SSA Free Multi-Point Inspection
Tech: P O

Labor:	SSA Free Multi-Point Inspection		
✓ Approved on 01/15/25 at 10:03 AM EST		*0*	**0**

2 - 04 Porsche Oil Change
Tech: P O

Labor:	Engine Oil & Filter Change		
Parts:	MOBIL 1 0W-40		8.7
	GASKET RING		1
	Wix oil filter		1
✓ Approved on 01/15/25 at 10:03 AM EST		*Subtotal $369.66 + est. Tax $9.04*	**$378.70**

All products and workmanship are warranteed for 36 months or 36,000 miles from the date of installation unless otherwise specified. All parts are new unless otherwise specified. I hereby authorize you and/or your agents to contact me regarding the products and services provided. An express mechanic's lein is hereby granted. I acknowledge receipt of a copy of this repair order. All estimates and quotes are valid for 90 days from the date of this repair order.

Thank you for your business!

Work Authorization Signature:

X

Total Jobs:	$369.66
Total Fees:	$6.75
Subtotal:	**$376.41**
Taxes:	$9.04
Grand Total:	**$385.45**
BALANCE DUE:	**$0.00**

✓ PAID

Payment History					Payment Signature
01/16/25	STEVEN EICHBERG	$385.45	Credit Card Payment	Visa**** 8421 Auth: 626689	Visa

SSA European Auto Repair
192 Summer Street
Kingston, MA 02364
(781) 585-5587
service@ssaeuro.com
http://www.ssaeuro.com

Invoice for RO #29718

Service Advisor: Dennis Burke
Date Created: 04/28/26 at 08:29 AM EDT
Client: STEVEN EICHBERG
Vehicle: 2001 Porsche 911 Carrera

[redacted]	2001 Porsche 911 Carrera 3.4L 6Cyl GAS 9601 Naturally Aspirated VIN: WP0CA29901S651691 License: PL1124 Color: N/A Odometer In: 68940 / Out: 68946	RO # 29718 Time-In: 04/28/26 at 08:29 AM EDT Promised Time-Out: 04/30/26 at 12:15 PM EDT Save Parts: No

0

[redacted] Oil Change / Check hoses, belts, fluid levels / Replace auto [redacted] on passenger side of car (lever only). Inspect brakes, Pressure adjustment on tires and check depth.

1 - 01 SSA Free Multi-Point Inspection
Tech: JB

Labor:	SSA Free Multi-Point Inspection MISSING LEVER ON THE PASSENGERS SIDE SEAT SWITCH CAN WE GET JUST THAT? CUSTOMER IS PLANNING ON SELLING, WANTS BRAKE AND TIRE MEASUREMENTS		

✓ Approved on 04/28/26 at 08:31 AM EDT — 0 — **0**

2 - 04 Porsche Oil Change
Tech: JB

Labor:	Engine Oil & Filter Change	
Parts:	GASKET RING	1
	MOBIL 1 0W-40	8.8
	oil filter	1

✓ Approved on 04/28/26 at 08:31 AM EDT — *Subtotal $426.05 + est. Tax $9.28* — **$435.33**

3 - Coolant reservoir cap leaking and needs to be replaced.

Part:	FEB Expansion Tank Cap	1

✓ Approved on 04/28/26 at 03:09 PM EDT — *Subtotal $90.90 + est. Tax $5.68* — **$96.58**

4 - Remove & Replace Engine Air Filter Element
Tech: JB

Labor:	Remove & Replace Engine Air Filter Element	
Part:	HEN Air Filter	1

✓ Approved on 04/28/26 at 03:09 PM EDT — *Subtotal $128.17 + est. Tax $5.14* — **$133.31**

5 - BRAKE - HOSE
Tech: JB

Labor:	REPLACE RUBBER BRAKE HOSES.	
Parts:	CLEANER	1
	CFW Brake Hose	4

✓ Approved on 04/28/26 at 03:09 PM EDT — *Subtotal $1,169.84 + est. Tax $16.87* — **$1,186.71**

6 - BG Brake System Service
Tech: JB

Labor:	Removes old & contaminated brake fluid from master cylinder, brake lines, ABS module & calipers. The service effectively extracts and replaces brake fluid from the vehicle, replacing the old fluid with BG Premium Brake Fluid. Service is performed according to OEM procedures. Upon completion, the system is inspected for leaks, and test driven.	
Part:	BG Super DOT 4 Brake Fluid	1

✓ Approved on 04/28/26 at 03:09 PM EDT **$249.00**

All products and workmanship are warranteed for 36 months or 36,000 miles from the date of installation unless otherwise specified. All parts are new unless otherwise specified. I hereby authorize you and/or your agents to contact me regarding the products and services provided. An express mechanic's lein is hereby granted. I acknowledge receipt of a copy of this repair order. All estimates and quotes are valid for 90 days from the date of this repair order.

Thank you for your business!

Work Authorization Signature:

X _____

Total Jobs:	$2,063.96
Total Fees:	$42.26
Subtotal:	**$2,106.22**
Taxes:	$36.97
Grand Total:	**$2,143.19**
BALANCE DUE:	**$0.00**

✓ PAID

Payment History

						Payment Signature
04/30/26	STEVEN EICHBERG	$2,143.19	Credit Card Payment	Visa**** 2918 Auth: 034401	Visa	

Declined Jobs:

1 - Remove & Replace Cabin Air Filter

✘ Declined on 04/28/26 at 03:09 PM EDT — *Subtotal $100.25 + est. Tax $4.11* — **$104.36**

2 - Tire - 4 Tires Mounted with Nationwide Road Hazard Protection Plan

✘ Declined on 04/28/26 at 03:09 PM EDT — *Subtotal $1,565.01 + est. Tax $70.89* — **$1,635.90**

Labor

Remove and Replace Both Front Fender Linings

Part	Qty
Porsche Lining	1
Porsche Lining	1
Porsche Rivet	13
Porsche Nut	10
Porsche Screw	4
Porsche Screw	6

Authorized on	June 17, 2026	at	01:10 PM	Subtotal	Est. Tax	Job Total
				$1,038.41	$41.78	$1,080.19

Note:

Description	Amount
Total Jobs	$1,038.41
Total Fees	$11.10
Subtotal	**$1,049.51**
Taxes	$41.78
Grand Total	**$1,091.29**
BALANCE DUE	**$0.00**

SSA European Auto Repair
192 Summer Street
Kingston, MA 02364
(781) 585-5587
service@ssaeuro.com
http://www.ssaeuro.com

Invoice for RO #30900

Service Advisor: Dan Lattin
Date Created: 07/10/26 at 06:45 AM EDT
Client: STEVEN EICHBERG
Vehicle: 2001 Porsche 911 Carrera

	2001 Porsche 911 Carrera 3.4L 6Cyl GAS 9601 Naturally Aspirated VIN: WP0CA29901S651691 License: PL1124 Color: N/A Odometer In: 69603 / Out: 69624	**RO # 30900** Time-In: 07/10/26 at 06:45 AM EDT Promised Time-Out: 07/16/26 at 05:00 PM EDT Save Parts: No

SSA / See a leak or puddle from the engine compartment. Our tech had noticed a leak in engine area. Will drop car off tomorrow and you can keep to see what is causing the leak, as we will be away until later on Thursday the 16th. You may send me what is going on on email or text, as will have limited access from Sunday to Thursday around 2pm.

1 - 01 SSA Free Multi-Point Inspection
Tech: A G

Labor:	SSA Free Multi-Point Inspection		
✓ Approved on 07/10/26 at 06:46 AM EDT		*0*	**0**

2 See a leak or puddle from the engine compartment. Our tech had noticed a leak in engine area. Will drop car off tomorrow and you can - keep to see what is causing the leak and advise.

✓ Approved on 07/10/26 at 06:46 AM EDT	*0*	**0**

3 - Remove and Replace Cam Adjuster Shoes, Reseal Cam Covers Including Motor Mounts, Axle Seals & AOS (Oil Leaking) (Pics Attached)
Tech: A G
Note:

Labor:	Remove and Replace Cam Adjuster Shoes, Reseal Cam Covers	
Parts:	LNE Oil Filter Adapter Spin On Adapter	1
	Wix Engine Oil Filter	1
	MOBIL 1 0W-40	8.8
	GASKET RING	1
	OES Timing Chain Guide Rail Kit	2
	oring	1
	TKU Cam Plug	6
	REI Gasket Sealer Reinzosil (70ml Tube)	1
	OEA Spark Plug Tube	6
	REI Access Cover Plate	2
	REI Oil Pump Seal	2
	ROW Coolant/Antifreeze G13 (Violet) 1 Gallon	2
	OEA Engine Mount	2
	MOTUL GEAR 300 75W90 1L	1
	OEA CV Joint Bolt M10 x 50mm	12
	OES Axle Nut	1
	ZF Drive Axle Seal	1
	VCO Oil Separator	1
	MTC Breather O-Ring	1
	Porsche O-Ring	1
	HJS Exhaust Clamp 55x95mm	2
	OEA Crankcase Vent Valve	1
	Cooling Hose	1

✓ Approved on 07/10/26 at 02:00 PM EDT	*Subtotal $8,266.62 + est. Tax $194.16*	**$8,460.78**

4 - Remove and Replace Front Lid Supports
Tech: A G
Note:

Labor:	Remove and Replace Front Lid Supports	
Part:	STB Hood Strut	2

✓ Approved on 07/10/26 at 02:00 PM EDT	*Subtotal $131.40 + est. Tax $8.21*	**$139.61**

PLYMOUTH TIRE & AUTO SERVICE INC

130-7 CAMELOT DRIVE
Plymouth, MA. 02360
Phone: (508)-747-3322

VISIT US @www.plymouthalignment.com

Invoice # 152305
Original Est # 182441

Balance Due: $1,157.24

2001 Porsche - 911 - Carrera
3.4L, H6 (207CI) VIN(A)
VIN: WP0CA2990 **1S651691**
Odometer: In 69,661

License Plate: 354ZW6 MA

Work Complete: 07/21/2026
Service Advisor:
Customer ID: 6459
Printed Date: 07/21/2026

		Part #	Qty/Hr	Sale	Total
4 WHEEL ALIGNMENT					**$1,157.24**
Labor	4WA 4WHEEL ALIGNMENT		1.10 hr		$159.95
Part	TIRE DISPOSAL	TD	4.00	$5.00	$20.00
Part	2254018 pirelli p zero as3	4083700	2.00	$209.95	$419.90
Part	2653518 pirelli pzero as3	4085000	2.00	$249.95	$499.90

Parts: $939.80 Labor: $159.95 Tax: $57.49 Total: $1,157.24

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Labor	$159.95
Parts	$939.80
Subtotal	**$1,099.75**
Taxes	$57.49
Order Total:	**$1,157.24**

Signature _____ Date _____ Time _____

Copyright © Mitchell Repair Information Company LB1124I

Experian AutoCheck Report

Report run: 09/23/2026 10:27:16 EDT

2001 Porsche 911 Carrera / Carrera 4

Convertible 2D (3.4L H6 FI Gasoline)

Owners - 3

VIN:	WP0CA29901S651691
Class:	Sport Car - Subcompact Luxury
Country of Assembly:	Germany
Vehicle Age:	25 year(s)
Estimated In Service:	01/10/2001
Last Reported Odometer:	58,085 (11/10/2020)

Vehicle Usage
Fleet, Lease

64 **83** 79

AutoCheck Score

Similar vehicles usually range between 64 and 79

Vehicle History at a Glance

State Title Brand
Clean

Auction Brand / Issues
No Issue

Accident / Damage
No Accidents or Damage Reported
No Issue

Open Recall Check
No Open Recalls

Insurance Loss / Transfer
No Issue

Odometer Check
Last reported odometer:
58,085 (11/10/2020)
No Issue

Certified Pre-Owned
No CPO Info Available

Service / Repair
3 Service Record(s) Reported
No Issue

Additional History
No Issues Reported

1 Year AutoCheck BUYBACK

This vehicle is eligible for Buyback Protection

Due to the vehicle's history showing no reported major state title brands. Terms & Conditions

No Accidents or Damage

There were no accidents or damage events disclosed to Experian AutoCheck for this vehicle. Since not all damage related events are reported to Experian AutoCheck, an inspection may provide added confidence in the vehicle's condition before purchase.

Airbag Deployed | Structural Damage | Overturned | No Damage

Recommended Maintenance

OEM Recommended Maintenance Schedule

Based on your vehicle's last reported mileage, these are the most recent and upcoming recommended maintenance intervals from your vehicle's manufacturer.

OEM Recommended Services

45000 Mile Service

- Air filter/s: Check the air filter condition, and if necessary, replace
- All other electrical equipment as well as indicator and warning lights: Check operation
- Brake fluid: Check level
- Brake hoses and lines: Visual inspection for damage, routing and corrosion
- Change engine oil and oil filter

60000 Mile Service

- Air filter: Replace filter element
- All other electrical equipment as well as indicator and warning lights: Check operation
- Axle joints: Check play; visual inspection of the dust boots for damage. Check the screw connections of the front and rear running gear adjustment joints are secure

75000 Mile Service

- Air filter/s: Check the air filter condition, and if necessary, replace
- All other electrical equipment as well as indicator and warning lights: Check operation
- Brake fluid: Check level
- Brake hoses and lines: Visual inspection for damage, routing and corrosion

Odometer Check

No odometer brands, rollbacks, rollover or tampering has been reported to AutoCheck from state Division of Motor Vehicles (DMV) or auction sources. AutoCheck also examined the sequence of reported odometer readings to determine if there are any potential discrepancies.

State Title Odometer Check
No issues reported

Auction Odometer Check
No issues reported

Odometer Calculation Check
No issues reported

Detailed Vehicle History

Below are the historical events for this vehicle listed in chronological order.
Vehicle: 2001 Porsche 911 Carrera / Carrera 4 (WP0CA29001S651691) **Report Run Date:** 09/23/2026 10:27:15 EDT

2001 - Owner 1

Location: KY **Owned From:** [redacted] **Usage:** [redacted]

Event Date	Location	Odometer	Data Source	Details
01/ 0/2001	KY	22	Motor Vehicle Dept.	Title(Leased Vehicle) Registration Event/Renewal(Leased Vehicle)
08/0 /2002	SHELBYVILLE, KY		Motor Vehicle Dept.	Registration Event/Renewal(Leased Vehicle)
12/13/2002	SHELBYVILLE, KY		Motor Vehicle Dept.	Registration Event/Renewal(Leased Vehicle)
03/ 0/2004	SHELBYVILLE, KY		Motor Vehicle Dept.	Registration Event/Renewal(Leased Vehicle)
02/07/2005	FL	18,478	Auto Auction	Reported at Auto Auction
03/08/2005	FL	18,478	Auto Auction	Auction Announced as Fleet/Lease
03/2 /2005	CA	18,488	State Agency	Passed Emission Inspection
04/08/2005	CA	18,494	Motor Vehicle Dept.	Odometer Reading from DMV

2005 - Owner 2

Location: CA **Owned From:** [redacted] **Usage:** [redacted]

Event Date	Location	Odometer	Data Source	Details
05/ 0/2005	LA QUINTA, CA		Motor Vehicle Dept.	Registration Event/Renewal

05/20/2005	LA QUINTA, CA		Motor Vehicle Dept.	Title
04/07/2007	CA	23,991	State Agency	Passed Emission Inspection Emission Inspection
04/10/2008	LA QUINTA, CA		Motor Vehicle Dept.	Registration Event/Renewal
02/21/2009	CA	27,903	State Agency	Passed Emission Inspection
04/09/2011	CA	30,899	State Agency	Passed Emission Inspection
04/09/2013	CA	34,720	State Agency	Passed Emission Inspection
06/[illegible]/2014	CA	35,476	State Agency	Passed Emission Inspection
06/30/2014	CHINO, CA	1,000 †	Independent Repair Center	Vehicle Serviced or Inspected

2014 - Owner 3

Location: MA | **Owned From:** 07/2014 | **Usage:** Personal

Event Date	Location	Odometer	Data Source	Details
07/16/2014	PLYMOUTH, MA		Motor Vehicle Dept.	Registration Event/Renewal
08/01/2014	PLYMOUTH, MA	35,557	Motor Vehicle Dept.	Title
07/20/2015	PLYMOUTH, MA	41,774	Independent Repair Center	Tires or Wheels Service Performed
12/1/2015	PLYMOUTH, MA		Motor Vehicle Dept.	Registration Event/Renewal
05/01/2016	PLYMOUTH, MA		Motor Vehicle Dept.	Registration Event/Renewal
05/01/2018	PLYMOUTH, MA		Motor Vehicle Dept.	Registration Event/Renewal
05/01/2020	PLYMOUTH, MA		Motor Vehicle Dept.	Registration Event/Renewal
11/10/2020		58,035	Independent Repair Center	Vehicle Serviced or Inspected
05/01/2022	PLYMOUTH, MA		Motor Vehicle Dept.	Registration Event/Renewal
05/01/2024	PLYMOUTH, MA		Motor Vehicle Dept.	Registration Event/Renewal
05/01/2026	PLYMOUTH, MA		Motor Vehicle Dept.	Registration Event/Renewal

† This odometer reading is inconsistent with the odometer history. This could be due to a typographical, clerical, or rounding error and does not necessarily represent an odometer rollback by itself. If we receive additional odometer history that corroborates an odometer rollback, this display may change and that may impact other aspects of this report and the vehicle's qualifications.

AutoCheck Terms and Conditions

This report, and any conclusions based, is subject to **AutoCheck Terms and Conditions**. If you did not receive the report directly from Experian, the vehicle identification has been provided to Experian by [illegible] and Experian has not verified that the vehicle identification provided is correct. Experian Automotive, C/O AutoCheck Customer Service, 18501 Von Karman Ave, Suite 400, Irvine, CA 92612.

Buyback Protection Terms and Conditions

This vehicle (VIN: [illegible]) qualifies for **AutoCheck Buyback Protection**. If you did not receive this report directly from a dealer, the dealer may not have provided the VIN you entered with your Claim. Buyback Protection Terms and Conditions are available to you at any time at www.autocheck.com/buybackterms or by writing to Experian Automotive, C/O AutoCheck Customer Service, 18501 Von Karman Ave, Suite 400, Irvine, CA 92612.